

Wagga Wagga Urban Salinity Technical Report

Prepared by the Directorate of Environmental and Community Services

2012/2013



City of
Wagga Wagga

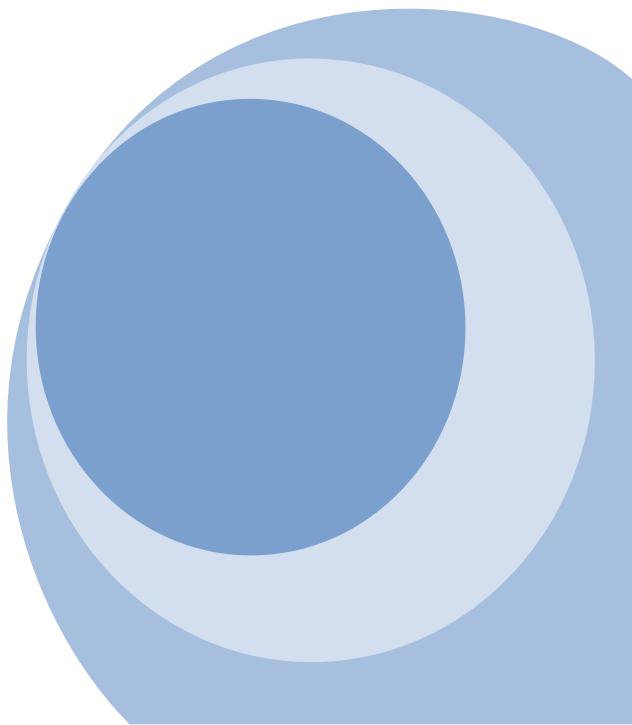


TABLE OF CONTENTS

1. INTRODUCTION	3
1.1 Annual Changes in Overall Standing Water Levels	3
2. MONITORING PROGRAM	5
3. RESULTS	7
3.1 Standing Water Levels.....	7
3.2 Critical Piezometers.....	16
3.3 Dewatering Bores.....	17
3. DISCLAIMER.....	18
4. REFERENCES	18

1. INTRODUCTION

The Wagga Wagga Urban Salinity Technical Report 2012/13 is a summary of data collected from Councils' urban salinity piezometer network and dewatering bores only. The report is a move away from the annual Urban Salinity Status Report format which contains a more holistic reporting approach to impact, attributing factors, monitoring networks and management plans regarding urban salinity in the Wagga Wagga LGA.

The Urban Salinity Status Report will now be published every three years, with the Urban Salinity Technical Report, containing results from monitoring networks for that reporting period, being published annually.

1.1 Annual Changes in Overall Standing Water Levels

For a broader interpretation of groundwater conditions, comparing annual groundwater conditions on a local scale can be done by presenting overall SWL results as a percentage of total piezometers measured. Changes in groundwater conditions (ie, SWL increase, decrease, stable and dry) are revealed when compared to previous years' data.

Figure 1 shows annual changes (as a percentage) in SWL for all piezometers in the Wagga Wagga LGA for annual reporting periods between 2005/06 - 2012/13. For example, of the one hundred and ninety two piezometers measured during the 2012/13 reporting period, 40% showed a decrease in SWL when compared to the previous years' readings, 28% increased in SWL, 26% were dry and 7% remained stable. This allows for overall trending of groundwater conditions for the region based on all piezometers recorded.

It can be seen that from 2006/07 to 2010/11 there was a quite steep rise in SWL increase (from 13 - 67% of all piezometers respectively), coinciding with a decline in both SWL decrease (33 - 7%) and piezometers in a dry state (37 - 26%).

For the current reporting period (2012/13), overall piezometers showing a SWL increase dropped, continuing a recent trend, from 41 - 28% when comparing results between 2011/12. The majority of these piezometers migrated to a SWL decrease change, increasing from 29 to 40% of all piezometers, when comparing the two reporting periods.

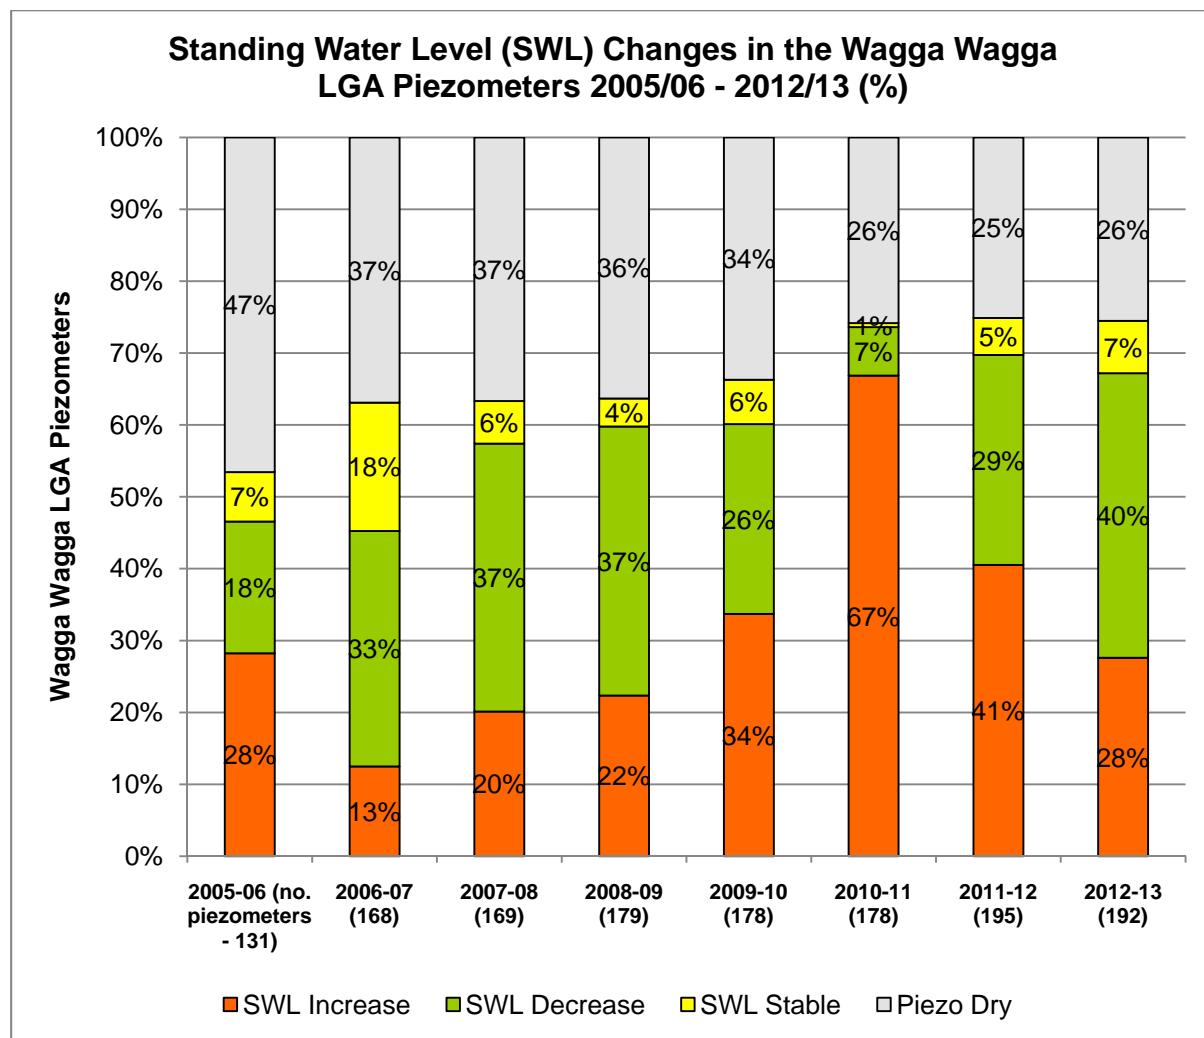


Figure 1: Graph depicting annual change in overall piezometer readings as a percentage of all piezometers in the Wagga Wagga LGA.

2. MONITORING PROGRAM

Piezometers located throughout the Wagga Wagga Local Government Area are maintained by Wagga Wagga City Council to monitor urban salinity. Established in 1998, the current monitoring network consists of 192 active piezometers (Figure 3). The piezometers were monitored on a monthly, bi-monthly or quarterly basis to examine trends, identify causes of the problem and potential risks areas.

Standing water level (SWL) and electrical conductivity (EC) readings are collected and used to monitor urban salinity. The SWL is measured in metres below the ground surface to the nearest centimetre using a water level meter. Measurements are taken from the height of the piezometer casing and the height of the extension subtracted from the reading. Piezometers at ground level do not require a subtraction. Water is extracted from the piezometer using a bailer to measure for EC. The EC is measured in decisiemens per metre (dS/m) to two decimal places using a handheld conductivity meter (Figure 2).



Figure 2: Measuring standing water level (left) and electrical conductivity (right) of groundwater.

Results of groundwater monitoring identify areas susceptible to saline discharge and monitor the effectiveness of Council's preventative and remedial measures.

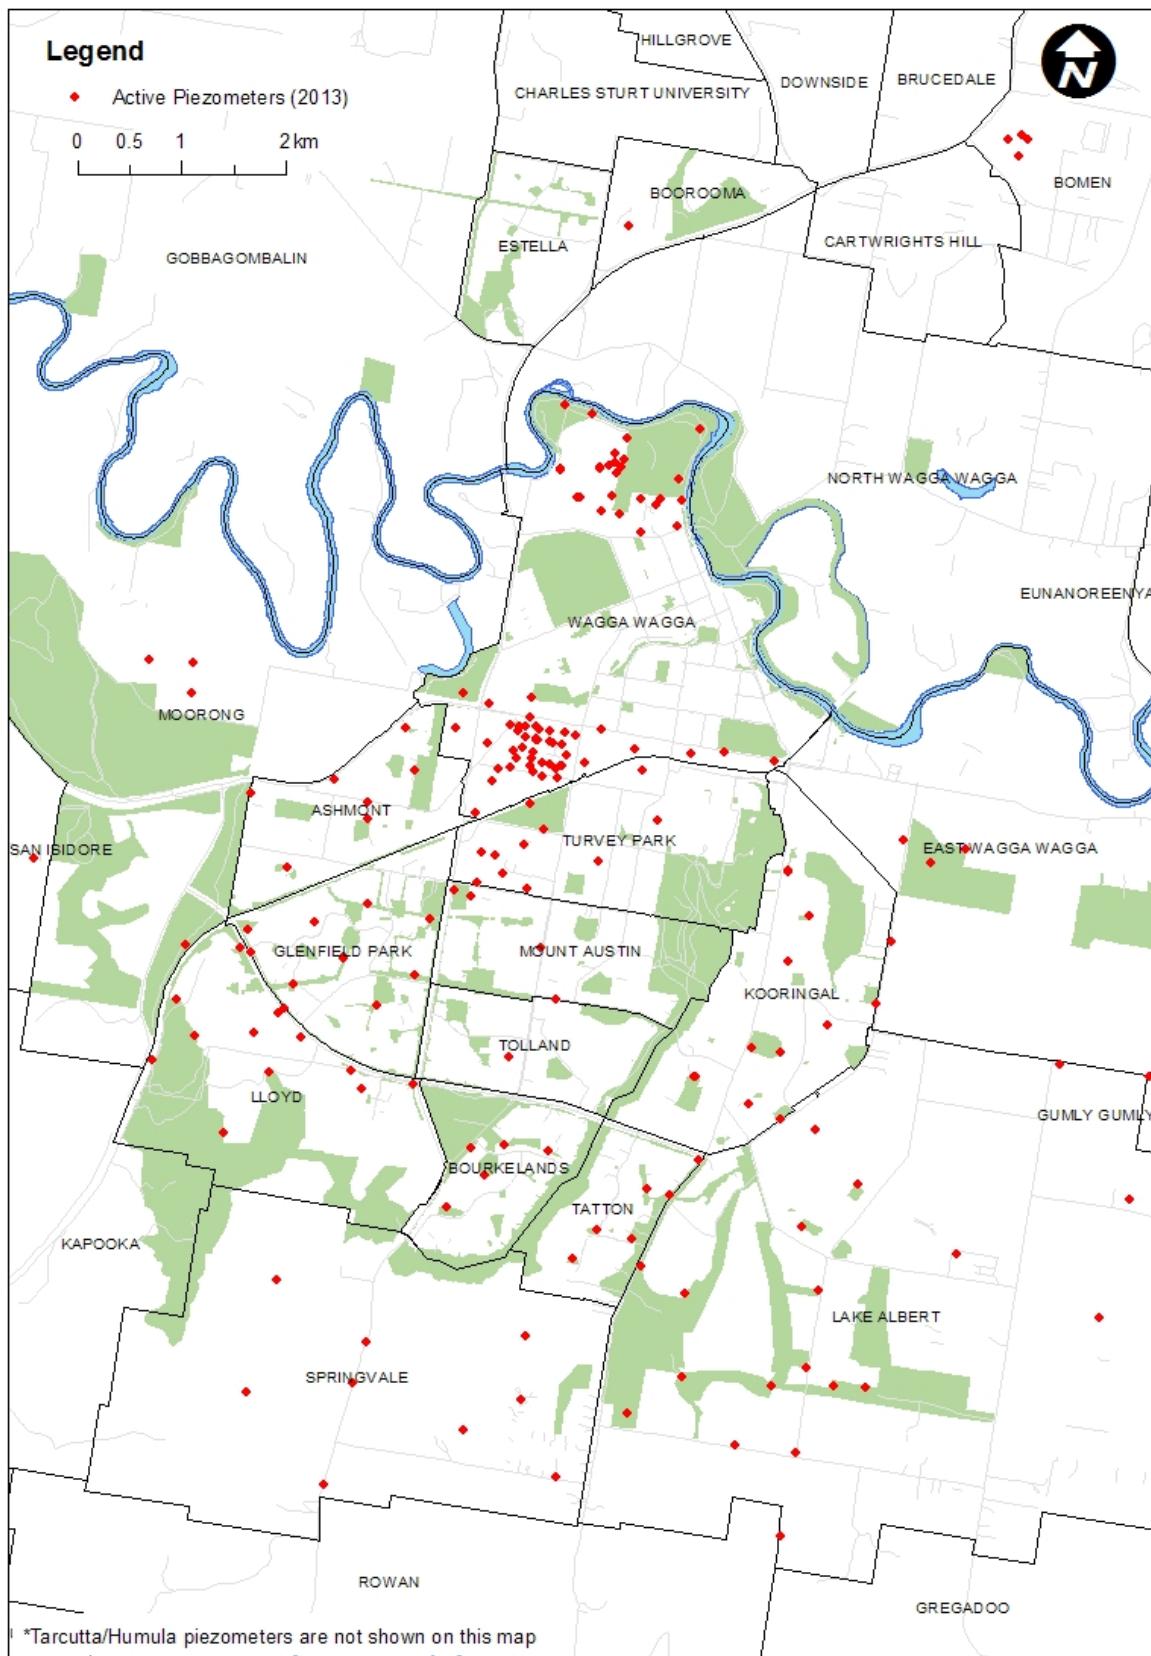


Figure 3: Location map of Wagga Wagga City Council's piezometer monitoring network

3. RESULTS

3.1 Standing Water Levels

The results discussed in this report relate to the change in the depth to the water table (standing water level) for all piezometers in the Wagga Wagga Local Government Area from July 2012 to June 2013 in relation to the results from the previous reporting period (July 2011 – June 2012).

To allow for meaningful interpretation of the data piezometers are grouped into eleven categories. Nine categories are based on the major sub-catchments identified by Golder (2007). Two additional groups (Undefined and Tarcutta/Humula) have been added to accommodate for piezometers outside the area recognised in the Golder (2007) study.

The eleven piezometer categories are:

- 1. Mid Murrumbidgee Alluvium (MA).** Forty one piezometers are located in the Mid Murrumbidgee Alluvium piezometers 1, 62, 72-76, 79-81, 105-116, 118, 120-127, 144-146, 164-166, 171, 177, 210 and Bore 9. These piezometers are associated with the Narrung Street Sewage Treatment Plant, the disused Wiradjuri Landfill and the northern section of the Calvary hospital precinct. In June 2013, a new piezometer was drilled at Duke of Kent Oval, Central Wagga.
- 2. North Western Sub-catchment (1).** Three piezometers 189-191 are located in the newly developed rural residential estate known as Riverview.
- 3. Far Western Sub-catchment (2).** Eleven piezometers are located in the Far Western Sub-catchment piezometers 18, 41, 54-55, 143, 174-175 and 199-202. The Far Western Sub-catchment piezometers incorporate areas of the suburbs of Ashmont, Glenfield and four recently drilled piezometers in Lloyd West
- 4. Western Sub-catchment (3).** Forty two piezometers are located in the Western Sub-catchment piezometers 2-3, 6-7, 9-15, 17, 34, 37-38, 40, 42-44, 47, 56-57, 128, 142, 147, 152, 172-173, 178-179, 185-188, 197-198 and 203-209. These piezometers are located in the suburbs of Ashmont, Turvey Park, Mt Austin, Lloyd, Glenfield, Tolland, central Wagga Wagga, Bourkelands and seven recently drilled piezometers in Lloyd West. In June 2013, two new piezometers were drilled in Glenfield.
- 5. CBD Sub-catchment (4).** Forty one piezometers are located in the CDB Sub-catchment piezometers 5, 16, 19-21, 39, 58-61, 63-69, 70-71, 78, 80, 82-90, 99-104,

176, 196, 1/1, 1/2 and 1/3. These piezometers are located in the Calvary hospital precinct and central Wagga Wagga.

6. **Eastern CBD Sub-catchment (5).** Four piezometers are located in the Eastern CBD Sub-catchment piezometers 91-92 and 194-195 are situated in the suburb of Kooringal.
7. **Far Eastern CBD Sub-catchment (6).** Three piezometers are located in the Far eastern CBD Sub-catchment piezometer 50 and 192-193. These piezometers are found in east Wagga.
8. **Eastern Sub-catchment (7).** Forty eight piezometers are located in the Eastern Sub-catchment piezometers 23-31, 36, 45, 48-49, 51, 53, 93-98, 129-140, 153-163, 170 and 180-184. The Eastern Sub-catchment is the largest catchment and incorporates the suburbs of Kooringal, Lake Albert, Glenoak and Springvale.
9. **Far Eastern Sub-catchment (8).** Three piezometers are located in the Far eastern Sub-catchment piezometers 167-169 situated in the suburb of Lake Albert.
10. **Undefined (O).** Seven piezometers are grouped within the undefined category as they fall outside the major Sub-catchments defined by Golder (2007). Piezometers 22, 32, 33, 148-151 are located at San Isidore, Forest Hill, Boorooma and Bomen.
11. **Tarcutta/Humula (T/H)** contains the 7 piezometers installed in the villages of Tarcutta and Humula (piezometers T1-T6, H1-H2).

Names given to the major sub-catchments by Golder (2007) Mid Murrumbidgee Alluvium, CBD sub-catchment, Western sub-catchment and Eastern sub-catchment formed the basis of names for the piezometers categories.

The change in standing water level for all piezometers is presented in Table 1. These results illustrate the number of individual piezometers recorded in each piezometer category per group during 2012/13. A discussion of each group can be found in subsequent sections of this report.

Table 1: Changes in standing water levels across piezometer groupings.

Change in SWL Category	MA	1	2	3	4	5	6	7	8	T/H	O	Total
SWL Increase	10	1	2	6	8	0	2	19	2	1	2	53
SWL Decrease	15	2	1	13	24	2	0	11	0	5	3	76
SWL Stable	2	0	1	6	2	0	0	2	0	0	1	14
Piezometer Dry	12	0	3	7	7	1	1	15	1	1	1	49
Total Piezometers	39	3	7	32	41	3	3	47	3	7	7	192

The change in SWL for each piezometer category during 2012/13 is presented in Figure 4.

The dataset shows that the greatest number of piezometers, seventy six (40%), have decreased in standing water level (SWL) when comparing SWL change between 2012/13 and 2011/12. Fifty three (28%) recorded an increase in SWL with forty nine (25%) piezometers remaining dry, during the reporting period. Fourteen (7%) piezometers remained stable (those with an increase/decrease of 5cm or less).

Piezometers that contained water in the previous year that are now dry have been included in the ‘SWL decreased’ category, whereas piezometers that started as dry but now contain groundwater have been included in the ‘SWL increased’ category. These results were omitted from average increase/decrease calculations. Graphs of individual piezometers containing groundwater have been placed in Appendix D.

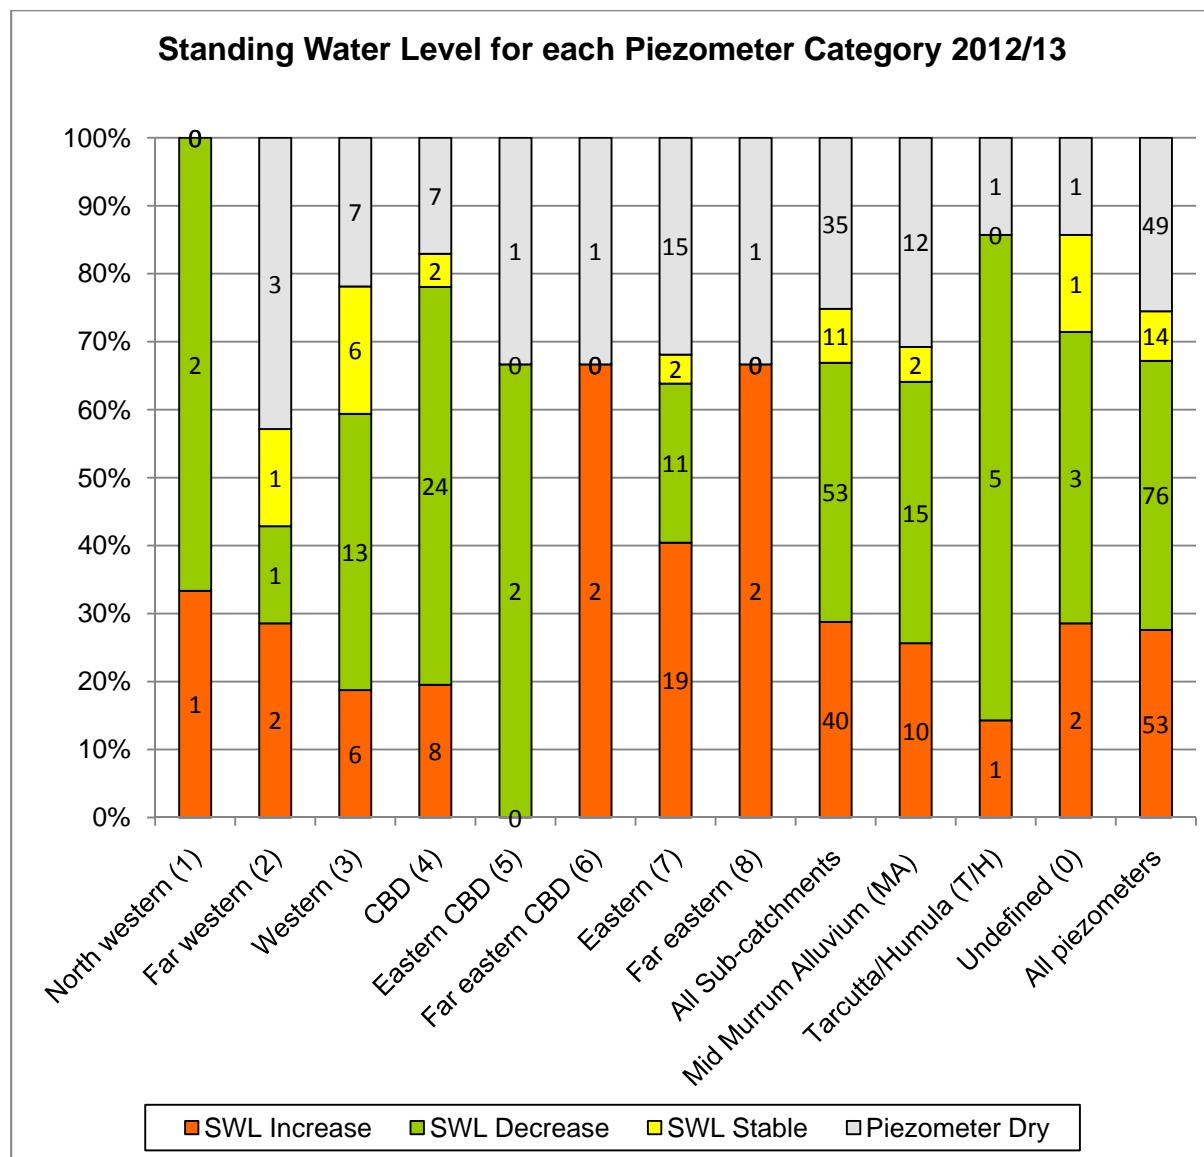


Figure 4: Chart depicting change in Standing Water Levels for each piezometer category

Mid Murrumbidgee Alluvium

The Mid Murrumbidgee Alluvium is the third largest piezometer category and contains 41 individual piezometers. Fifteen of the piezometers located in the Mid Murrumbidgee Alluvium decreased in SWL for the reporting period. Twelve piezometers remained dry, with ten experiencing an increase in SWL.

Mid Murrumbidgee Alluvium (MA)			
Increased	10	15	Decreased
Average	0.61	-0.56	Average
Maximum	3.25	-2.58	Maximum
Minimum	0.07	-0.06	Minimum

Piezometers increasing in SWL recorded an average increase of 0.61m. The piezometer with the greatest increase in SWL is located at the Narrung St Treatment Plant. Decreasing piezometers decreased by an average of -0.56m. The greatest decrease in SWL was also recorded at the Narrung St Treatment Plant.

Far Western Sub-catchment

Seven piezometers are located in the Far Western Sub-catchment. Of these piezometers, two increased in SWL with three piezometers remaining dry throughout the reporting period.

Far Western Sub catchment (2)			
Increased	2	1	Decreased
Average	0.60	-0.16	Average
Maximum	0.86	-0.16	Maximum
Minimum	0.34	-0.16	Minimum

Increases in SWL ranged between 0.34m and 0.86m for piezometers in the Far Western Sub-catchment.

Western Sub-catchment

Of the forty two piezometers measured within the Western Sub-catchment, thirteen decreased in SWL, with seven remaining dry for the 2012/13 reporting period, and six increasing.

Western Sub-Catchment (3)			
Increased	6	13	Decreased
Average	1.03	-0.27	Average
Maximum	2.17	-0.42	Maximum
Minimum	0.10	-0.11	Minimum

Average SWL for increasing piezometers within the Western Sub-catchment were 1.03m, ranging from 0.10m to 2.17m. Highest increases were found in Glenfield, with piezometer no.11 (drilled depth 7.10m) displaying a increase in SWL of 2.17m to an average SWL of 2.18m below the surface.

The average SWL in Western Sub-catchment water bearing piezometers is 5.27m. This figure represents a stabilising of groundwater conditions when compared to the 2011/12 reporting period of 5.19m.

Water bearing piezometers located at Charles Sturt University South Campus area showed an overall decrease of extremely high groundwater conditions in SWL, with changes of -0.01m to -0.42m over the reporting period.

CBD Sub-catchment

The CBD Sub-catchment is greatly influenced by the management of the dewatering bore scheme in the Intensive Borefield. High average increases and decreases in SWL of piezometers within close proximity of the Intensive Borefield can be correlated to the dewatering bore operations.

Of the forty one CBD Sub-catchment piezometers, twenty four (59%) showed decreasing SWL, eight revealed increasing SWL, two remained stable and seven remained dry over the 2012/13 reporting period.

CBD Sub Catchment (4)			
Increased	8	24	Decreased
Average	1.19	-0.44	Average
Maximum	3.75	-1.53	Maximum
Minimum	0.06	-0.06	Minimum

Average SWL decreases of -0.44m were reported across 24 water bearing piezometers within the CBD Sub-catchment during the 2012/13 reporting period.

Eight piezometers revealed an average increase of 1.19m in SWL with piezometer no.1/3 (Emblen Park) showing a maximum increase of 3.75m at an average SWL of 21.84m. This piezometer is drilled to a depth of 60.0m and reveals the 'natural' inflow rate of a deeper piezometer when the dewatering is switched to the OFF position.

The average SWL for 2012/13 in CBD Sub-catchment water bearing piezometers is 9.59m. This figure represents a decrease in SWL of 0.42m when compared to the 2011/12 reporting period.

Eastern CBD Sub-catchment

Limited piezometers are situated in the Eastern CBD sub-catchment. Of the three piezometers monitored, two decreased at an average SWL of -0.19 and one remained dry.

Eastern CBD Sub-Catchment (5)			
Increased	0	2	Decreased
Average	-	-0.19	Average
Maximum	-	-0.22	Maximum
Minimum	-	-0.16	Minimum

In the eastern CBD sub-catchment two nested piezometers (shallow and deep) in Mount St, Kooringal showed a decrease of groundwater conditions in 2012/13 after a stabilisation in the previous reporting.

Far eastern CBD Sub-catchment

As a small sub-catchment minimal data on the SWL is available for the far eastern CBD piezometer category. Both water bearing piezometers showed an average increase in SWL of 0.83m with average SWL's of 8.87m and 16.24m respectively. This is on top of average SWL increases of 0.67m in 2011/12. One piezometer remained dry.

Far Eastern CBD Sub-Catchment (6)			
Increased	2	0	Decreased
Average	0.83	-	Average
Maximum	0.85	-	Maximum
Minimum	0.80	-	Minimum

Eastern Sub-catchment

The Eastern sub-catchment is the largest sub-catchment and contains 47 piezometers, the largest number of piezometers within a sub-catchment. The 2012/13 reporting period revealed similar increase to decrease ratios as the previous year. Nineteen (40%) of Eastern Sub-catchment piezometers showed an increase in SWL, with eleven (23%) revealing a decrease in SWL and fifteen (32%) remaining dry over the 2012/13 reporting period.

Eastern Sub-Catchment (7)			
Increased	19	11	Decreased
Average	0.61	-0.39	Average
Maximum	3.50	-0.83	Maximum
Minimum	0.12	-0.09	Minimum

Increasing SWL piezometers within the Eastern sub-catchment ranged from 3.50m to 0.12m with an average increase of 0.58m across nineteen piezometers. The highest SWL increase

of 3.50m was found at the deep piezometer no. 53, located at the Lawn Cemetery, Lake Albert.

The average SWL in the Eastern Sub-catchment water bearing piezometers is 10.39m. This figure represents a increase in SWL of 0.12m when compared to the 2011/12 reporting period.

Far eastern Sub-catchment

The far eastern sub-catchment covers the second largest area of all the sub-catchments, containing mainly larger rural residential landholdings. Coverage of piezometers in this sub-catchment is poor and may not be a true indication of the sub-catchment as a whole. Of the three piezometers located in the sub-catchment, two piezometers increased in SWL, continuing the trend for the 2012/13 reporting period. The remaining piezometer stayed dry during the reporting period.

Far Eastern Sub-Catchment (8)			
Increased	2	0	Decreased
Average	1.19	-	Average
Maximum	1.45	-	Maximum
Minimum	0.93	-	Minimum

Two piezometers (no.168 and 169) on Bakers Lane, Lake Albert showed increases in SWL of 1.45m and 0.93m respectively.

Undefined

Piezometers within this category are located outside the sub-catchments defined by Golder (2007) and are therefore widespread. Three piezometers experienced a decrease in SWL, two increased in SWL, with one piezometer remaining dry and one remaining stable.

Undefined (0)			
Increased	2	3	Decreased
Average	0.88	-0.18	Average
Maximum	1.28	-0.27	Maximum
Minimum	0.47	-0.10	Minimum

Three piezometers located at the Bomen Industrial Sewage Treatment Facility showed a decrease in SWL of between 0.10m - 0.27m. San Isidore piezometer no.22 increased in

SWL by 0.47m to an average SWL depth of 16.13m. Piezometer no.32 (drill depth 16.0m) located at Forest Hill has remained dry since drilling in 1995. Boorooma piezometer no.33 increased in SWL by 1.28m to an average SWL depth of 13.73m.

Tarcutta/Humula

Seven piezometers are located in the rural villages of Tarcutta and Humula. Five piezometers revealed a decrease in SWL over the 2012/13 reporting period of between 0.27m - 0.42m, one piezometer showed an increase in SWL of 0.46m, and one remaining dry.

Tarcutta-Humula (T/H)			
Increased	1	5	Decreased
Average	0.46	-0.35	Average
Maximum	0.46	-0.42	Maximum
Minimum	0.46	-0.27	Minimum

3.2 Critical Piezometers

Piezometers with both EC concentrations (>5 dS/m) and a high SWL ($<5m$) can indicate urban salinity concerns. The criteria of EC greater than 5 dS/m and SWL of less than 5 metres has been taken from the previous reports to maintain consistency of which piezometers and surrounding areas are most susceptible to urban salinity problems (Table 2).

Table 2: Critical piezometers, piezometers displaying high Standing Water Levels ($<5.00m$) and Electrical Conductivity (>5 dS/m) in 2012/13.

Piezometer Number	Location	Urban Sub catchment	Average SWL 2012/13 (m)	Average EC 2012/13 (dS/m)
54	Derna Pl, Ashmont	2	-1.52	11.20
18	Nathan Park, Ashmont	2	-1.19	9.08
147	South Campus, Turvey Park	3	-0.81	16.93
57	7 Mortimer Pl, Central Wagga	3	-0.79	14.26
9	South Campus, Turvey Park	3	-0.31	9.17
89	31 Chaston St, Central Wagga	4	-3.32	12.06
90	51 Chaston St, Central Wagga	4	-2.11	8.91
60	Opp 16 Cullen Rd, Central Wagga	4	-2.58	7.91
58	62 Chaston St, Central Wagga	4	-0.99	5.08
29	Dalkeith Ave, Lake Albert	7	-2.47	6.16

Ten piezometers (compared 13 in 2011/12 to 16 in 2010/11) recorded both an EC greater than 5 dS/m and SWL of less than 5 metres in the reporting period. Piezometers with these characteristics are critical and have the potential to cause extensive damage to the surrounding environment. The surrounds of piezometers in Table 2 are at risk from urban salinity due to their high standing water levels.

Six of the ten ‘members’ of the critical piezometer list are located in urban salinity ‘hotspot’ areas of CSU South Campus, Showgrounds and the Calvary Hospital area (CBD sub catchments 3 and 4). Piezometers no. 18 and 54 are located in the Ashmont area of the far Western Sub catchment. Standing water levels of piezometer no. 29 (located at Dalkeith Ave, Lake Albert) may be high due to lateral influences of Lake Albert.

Critical piezometers provide valuable data on target areas for remediation action. The increasing severity within these critical areas especially in area noted for high salinity levels is concerning for urban salinity management in Wagga Wagga.

3.3 Dewatering Bores

The dewatering bores of the Intensive borefield are monitored monthly allowing for the volume of water and amount of salt discharged to the Murrumbidgee River to be calculated (Table 3). Groundwater from the Intensive Borefield is pumped to the Murrumbidgee River via a pump station adjacent to the intersection of the Sturt Highway and Moorong Street.

Table 3: Intensive Borefield salt load calculations for July 2012 – June 2013.

Bore number	Bore Location	Volume Pumped (m ³)	Pump Hours	Average EC (dS/m)	Salt Discharged (tonnes)
1	Emblen Park	24,566.85	5,999.68	1.46	22.89
2	Meurant - Emblen roundabout	412.98	337.25	2.53	0.67
3	19 Sullivan Ave	6,901.13		ongoing repairs - no data	
4	3 Cullen Rd	194.20	9.71	1.39	0.17
5	Calvary Hospital Carpark	44,591.73	7,950.58	2.09	59.70
6	Docker St - Meurant Ave	0.11	6,152.73	4.08	0.00
7	9 Hardy Ave	19,257.96	7,909.01	2.93	36.16
8	25 Gormly Ave	6,484.82	2,083.89	2.39	9.93
10	Chaston St - Foxborough Ave	20,272.14	1,697.64	2.12	27.53
		Total	122,681.93	38,707.45	157.04
		Average (per bore)	15,335.24	4,838.43	19.63
		Average (per day)	336.11	106.05	0.43

Bore 3 requires ongoing repairs and as a result data is not available for 2012/13.

A daily average of 336.11 cubic metres (336,110 litres) of groundwater from eight dewatering bores was pumped into WWCC's stormwater system during 2012/13 (slightly up from 321,480 litres in 2011/12). Based on EC readings, this volume represents average daily discharges of 0.43 tonnes (430kg) of salt from groundwater aquifers below the Calvary Hospital precinct (slightly down from 490kg in 2011/12).

At present, Wagga Wagga City discharges this saline water to the river. Investments in revegetation, rear of block drainage and education programs are considered by Council as sufficient offsets to permit the discharge of moderately saline water.

3. DISCLAIMER


This report has been compiled by Wagga Wagga City Council's Department of Environmental & Community Services exercising all due care and attention. Council does not accept any responsibility for any inaccurate or incomplete information supplied by third parties. No representation is made as to the accuracy, completeness or suitability for any particular purpose of the source material included in this report.

4. REFERENCES


Golder Associates Pty Ltd (2007). *Wagga Wagga Urban Salinity – Water level and Quality Study (1999-2006)*. Golder Associates, Perth.

**APPENDIX A:
MAPS OF PIEZOMETER LOCATIONS**


Piezometer Locations: Mid Murrumbidgee Alluvium

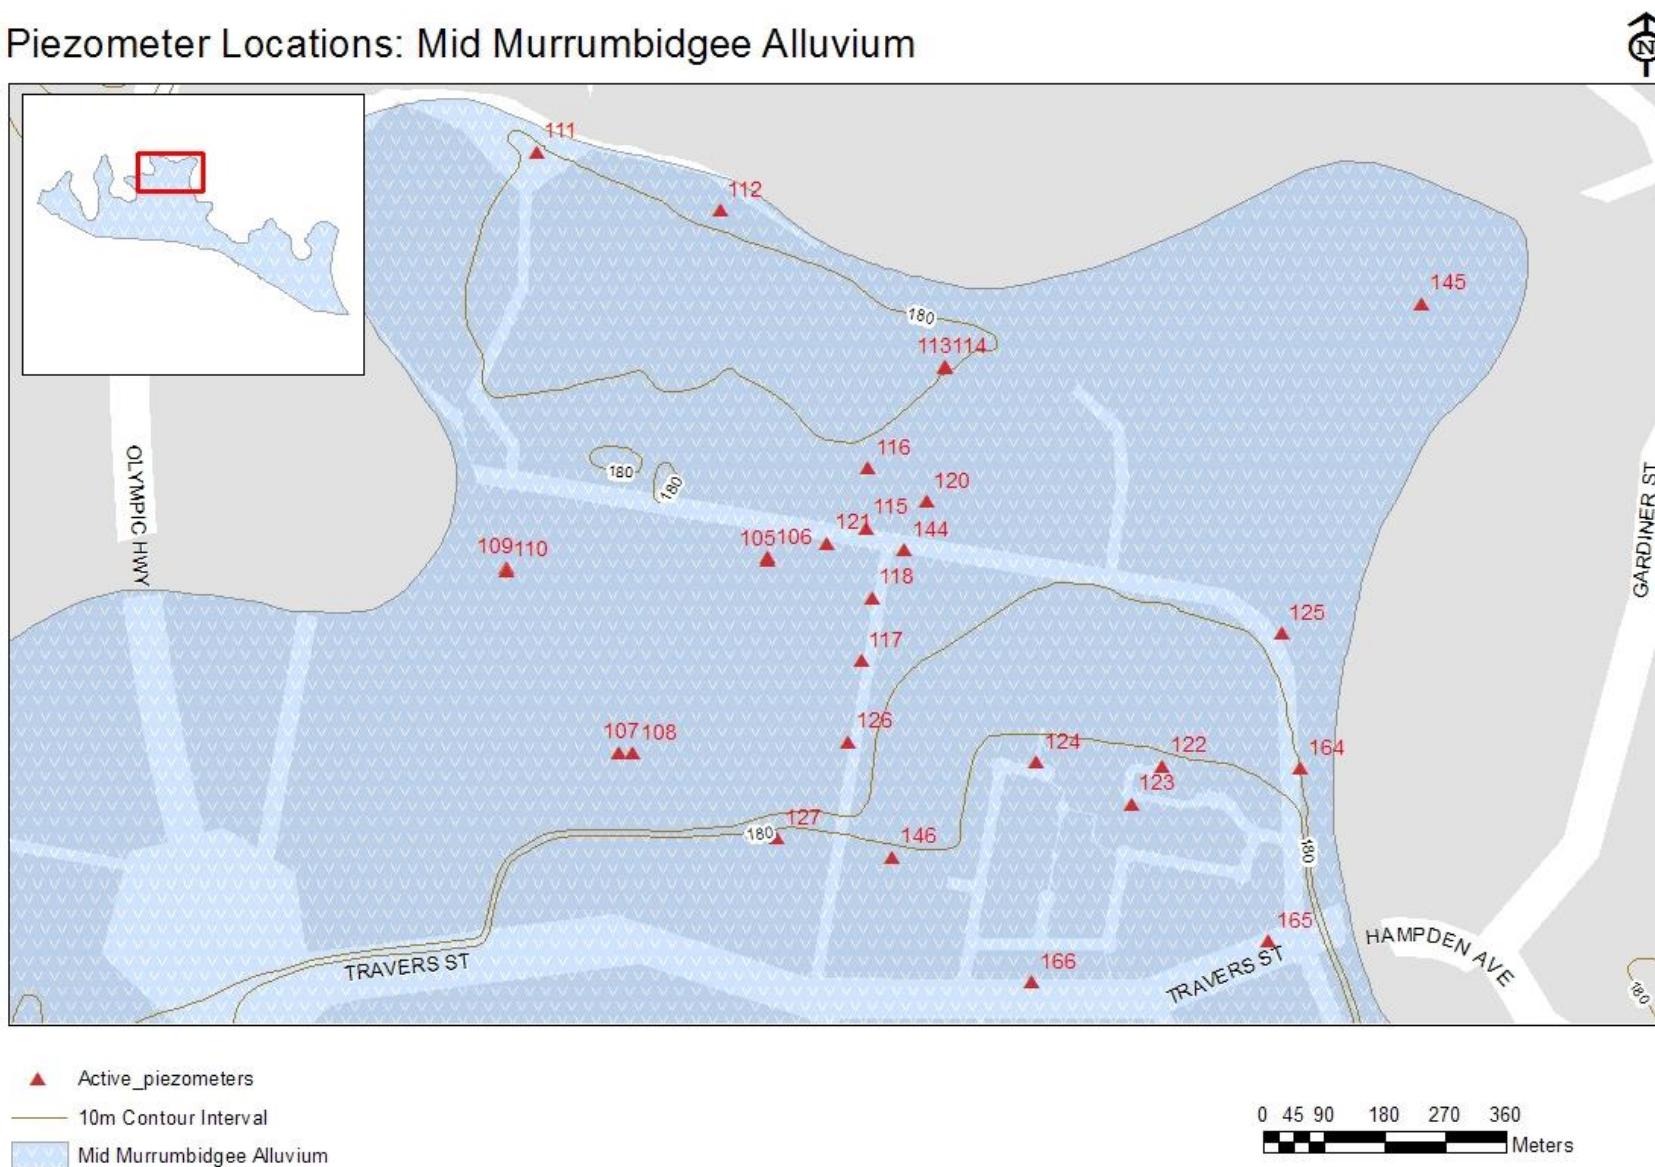


Piezometer Locations: Mid Murrumbidgee Alluvium

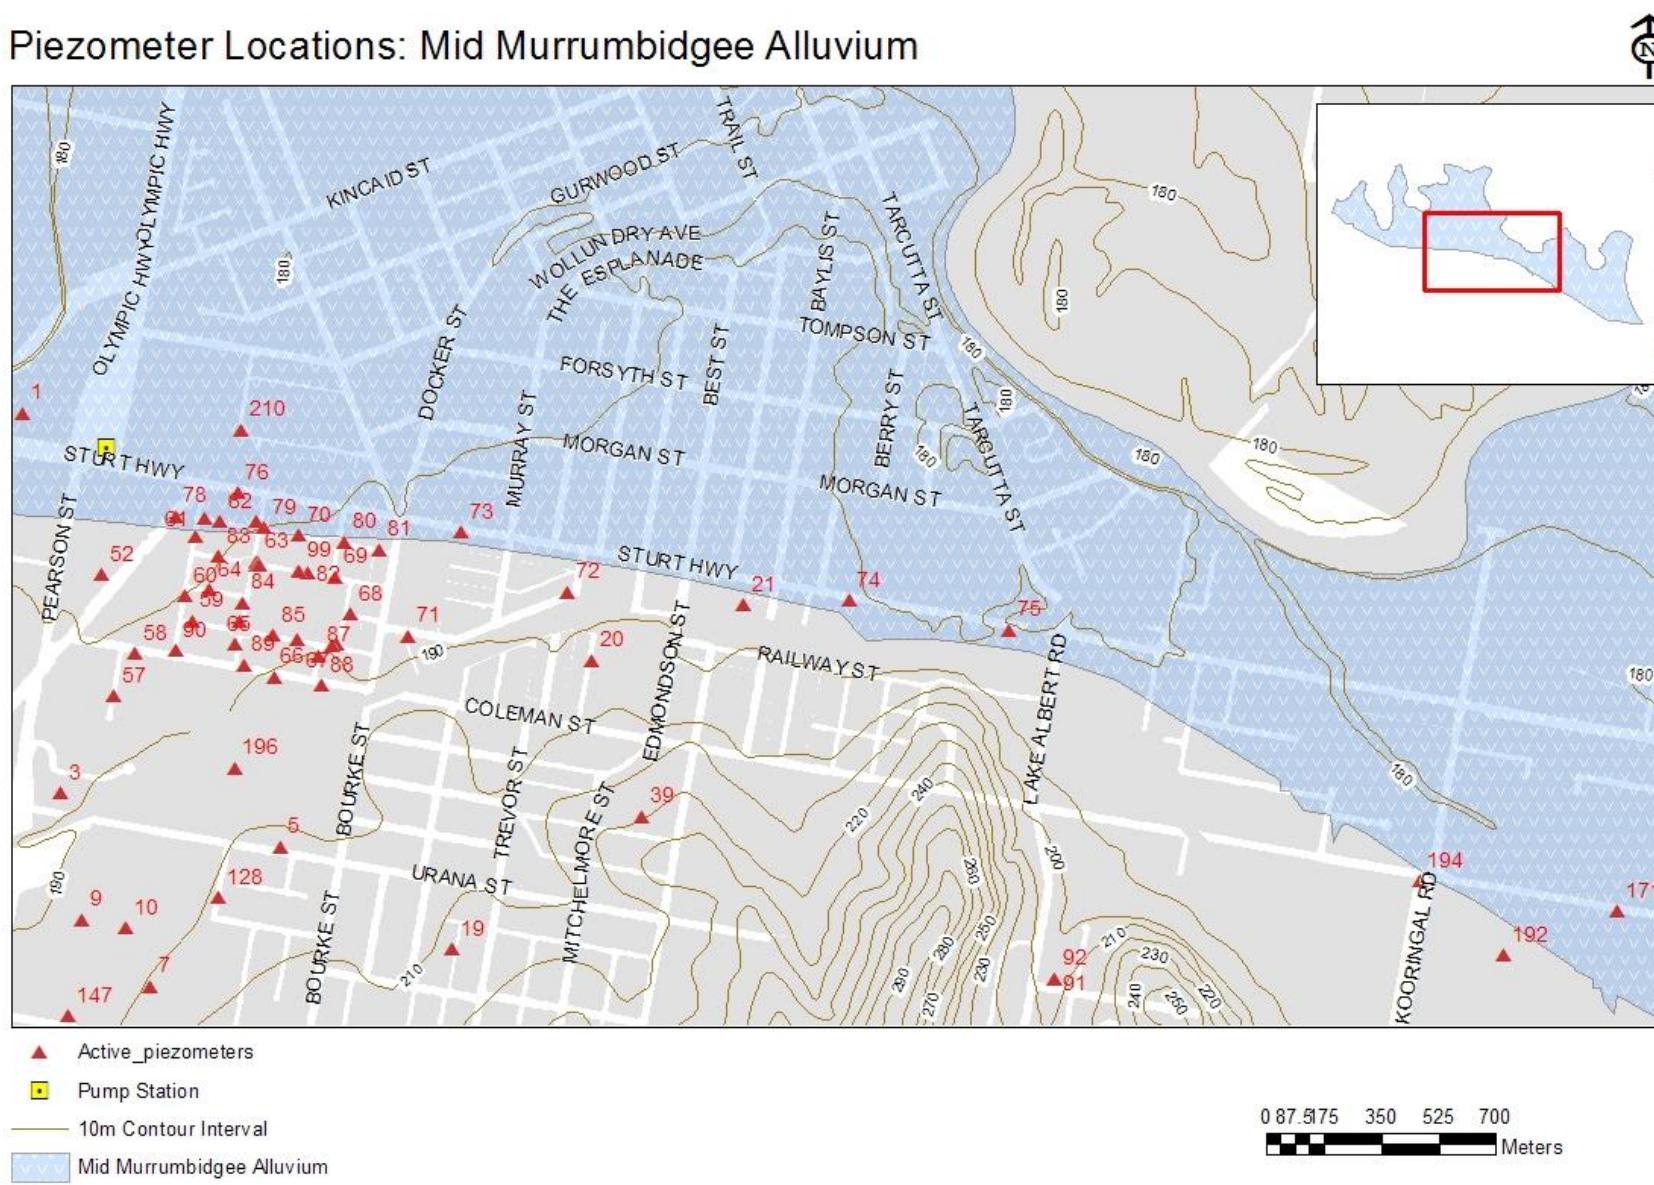


Piezometer Locations: North Western Sub-catchment

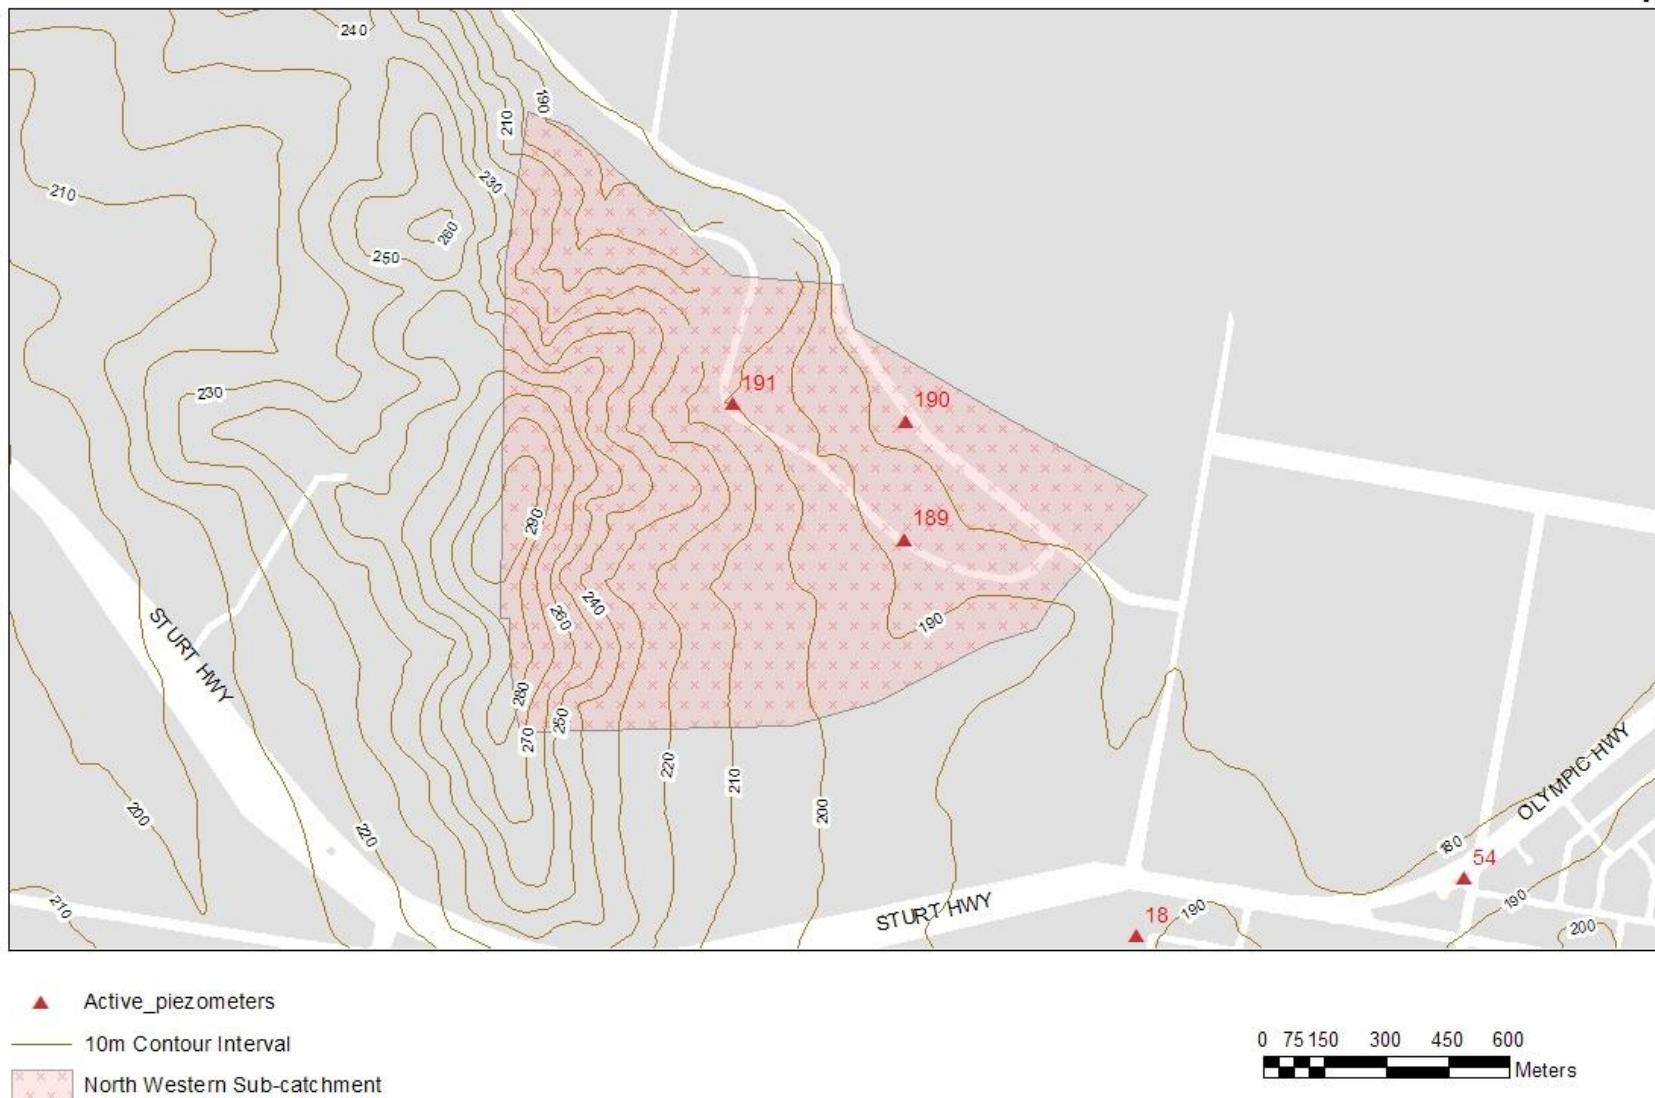


Piezometer Locations: Far Western Sub-catchment

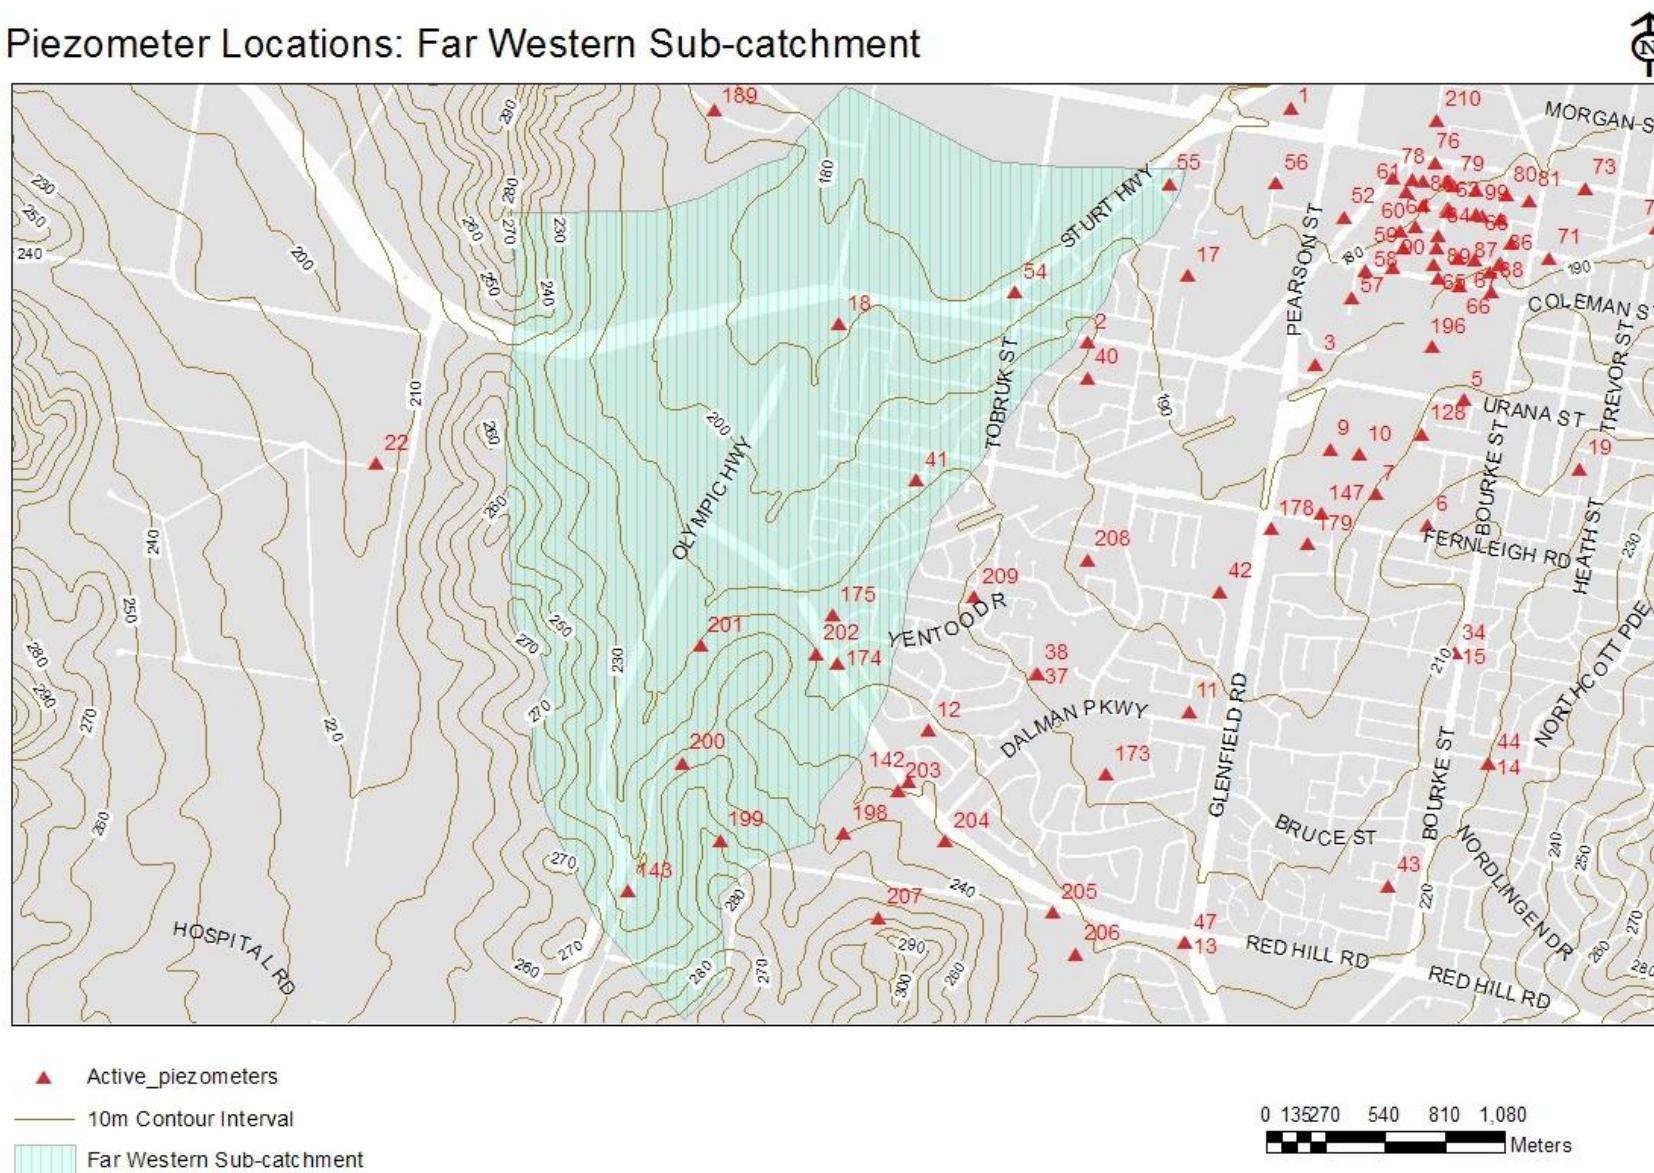


Piezometer Locations: Western Sub-catchment

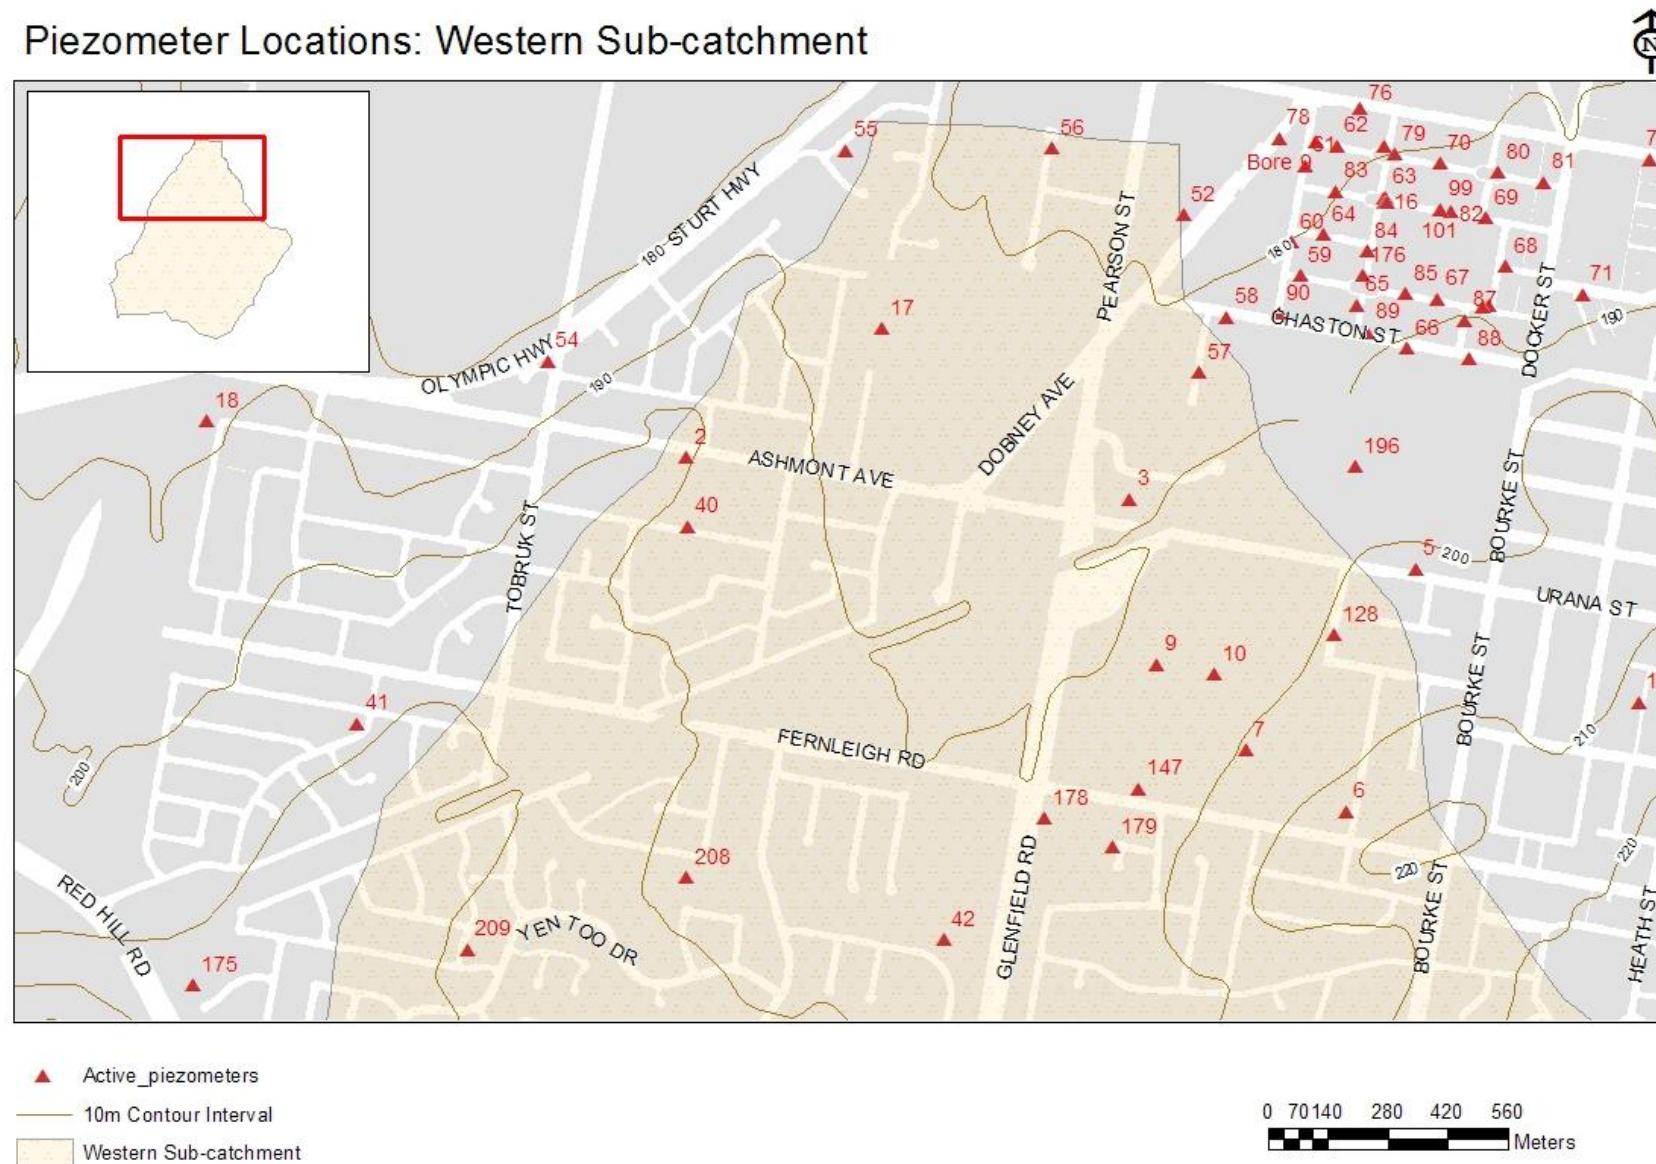

Piezometer Locations: Western Sub-catchment

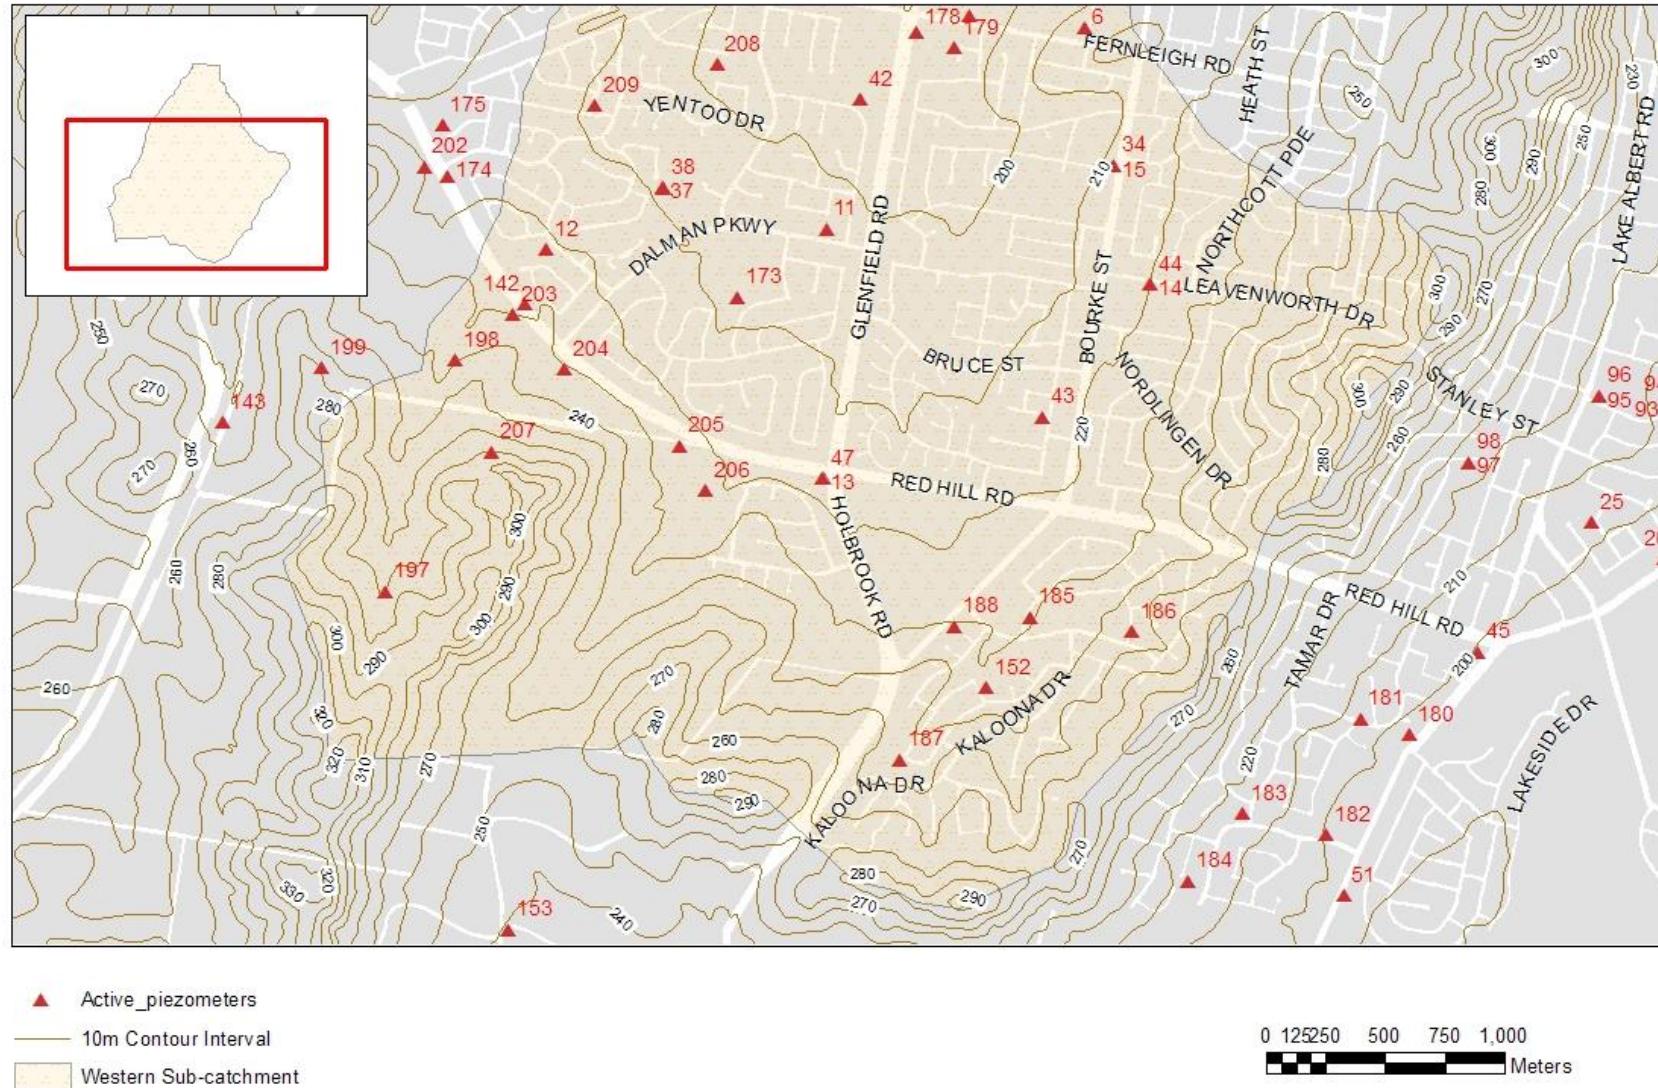


Piezometer Locations: CBD Sub-catchment

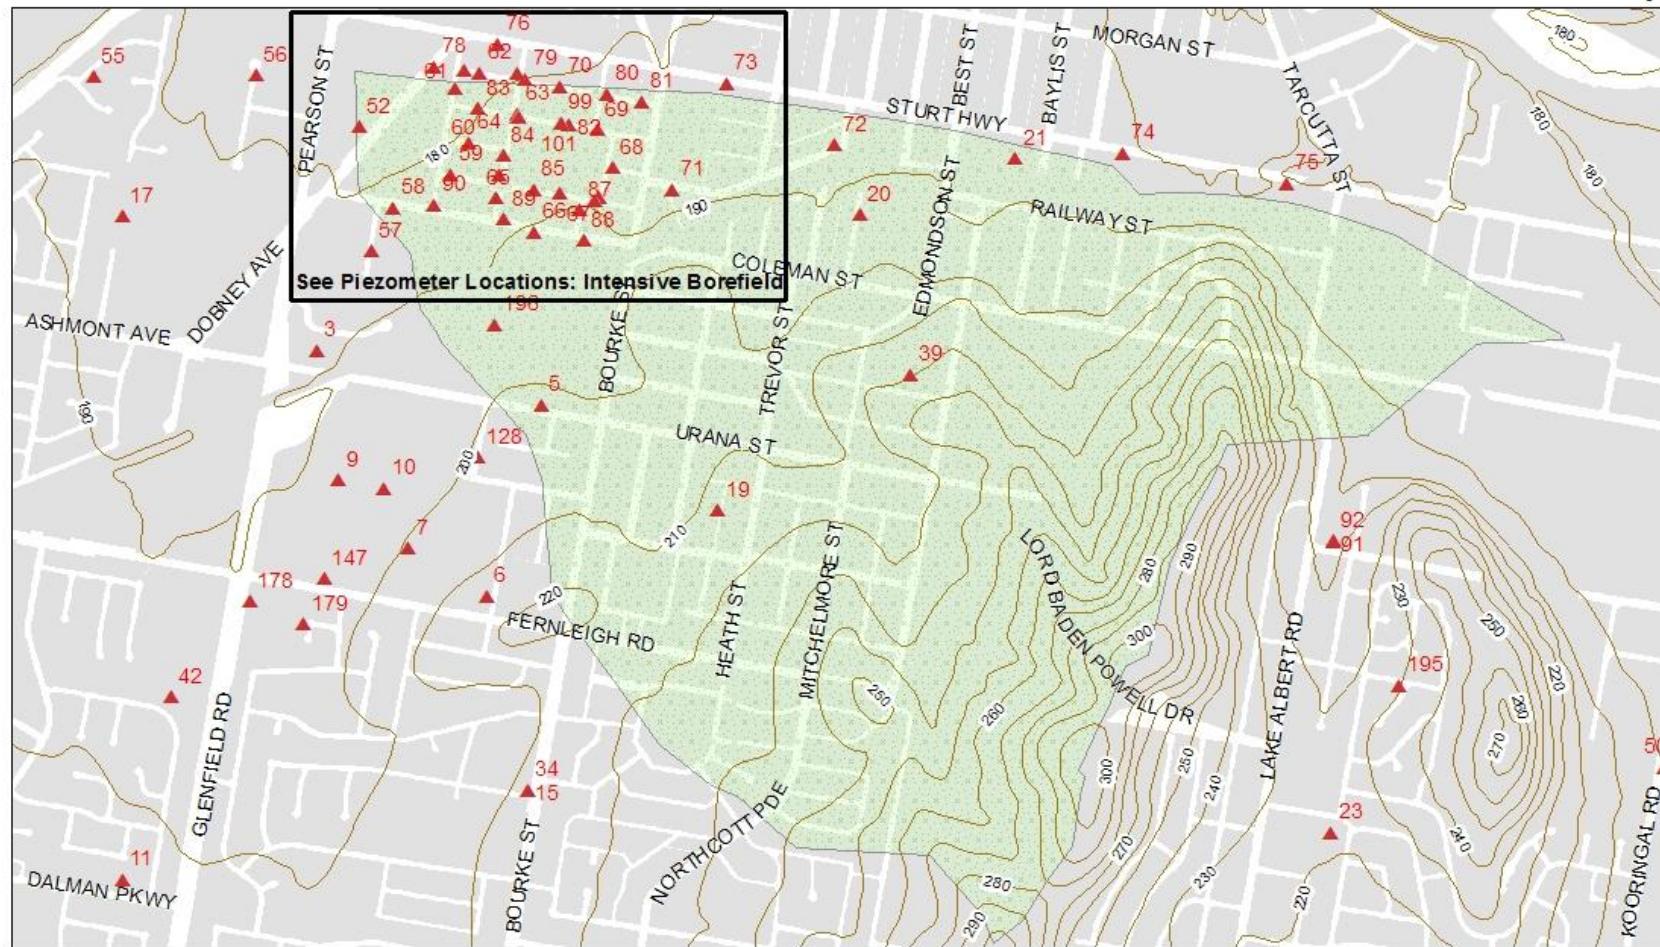


0 87.5 175 350 525 700
Meters


Piezometer Locations: Intensive Borefield

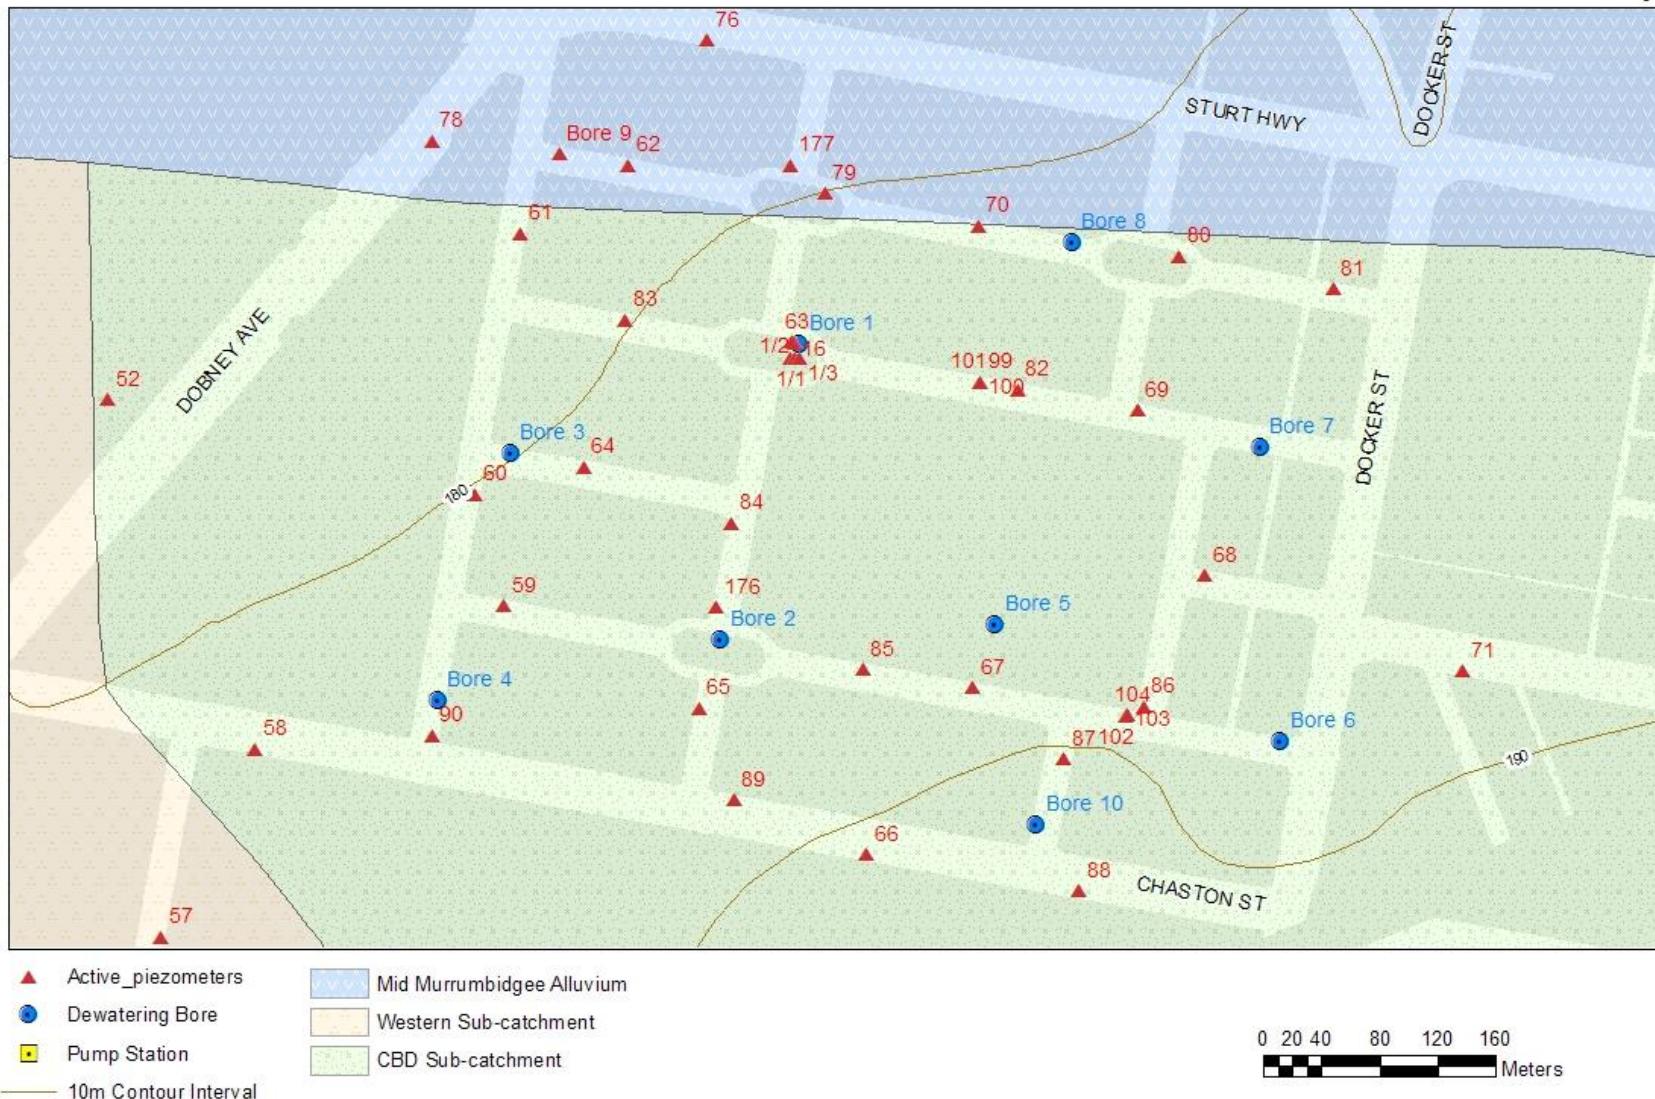


Piezometer Locations: Eastern CBD Sub-catchment

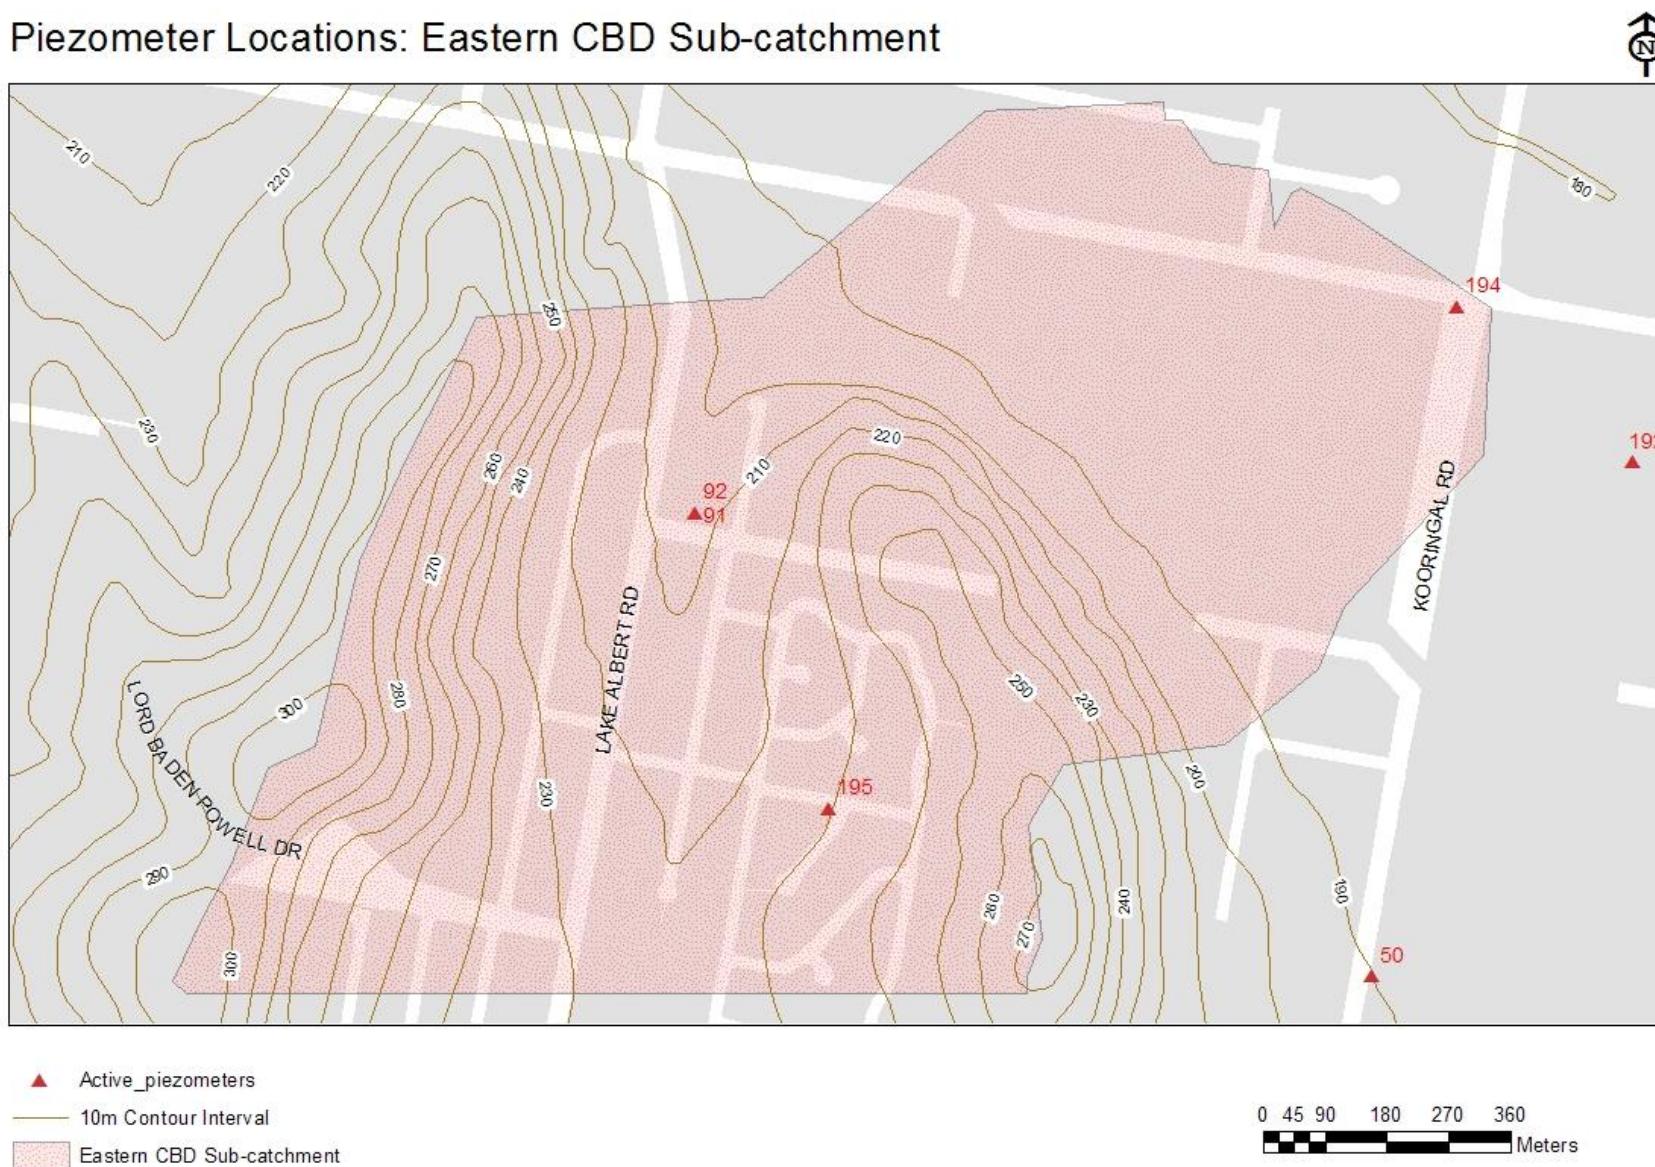


Piezometer Locations: Far Eastern CBD Sub-catchment

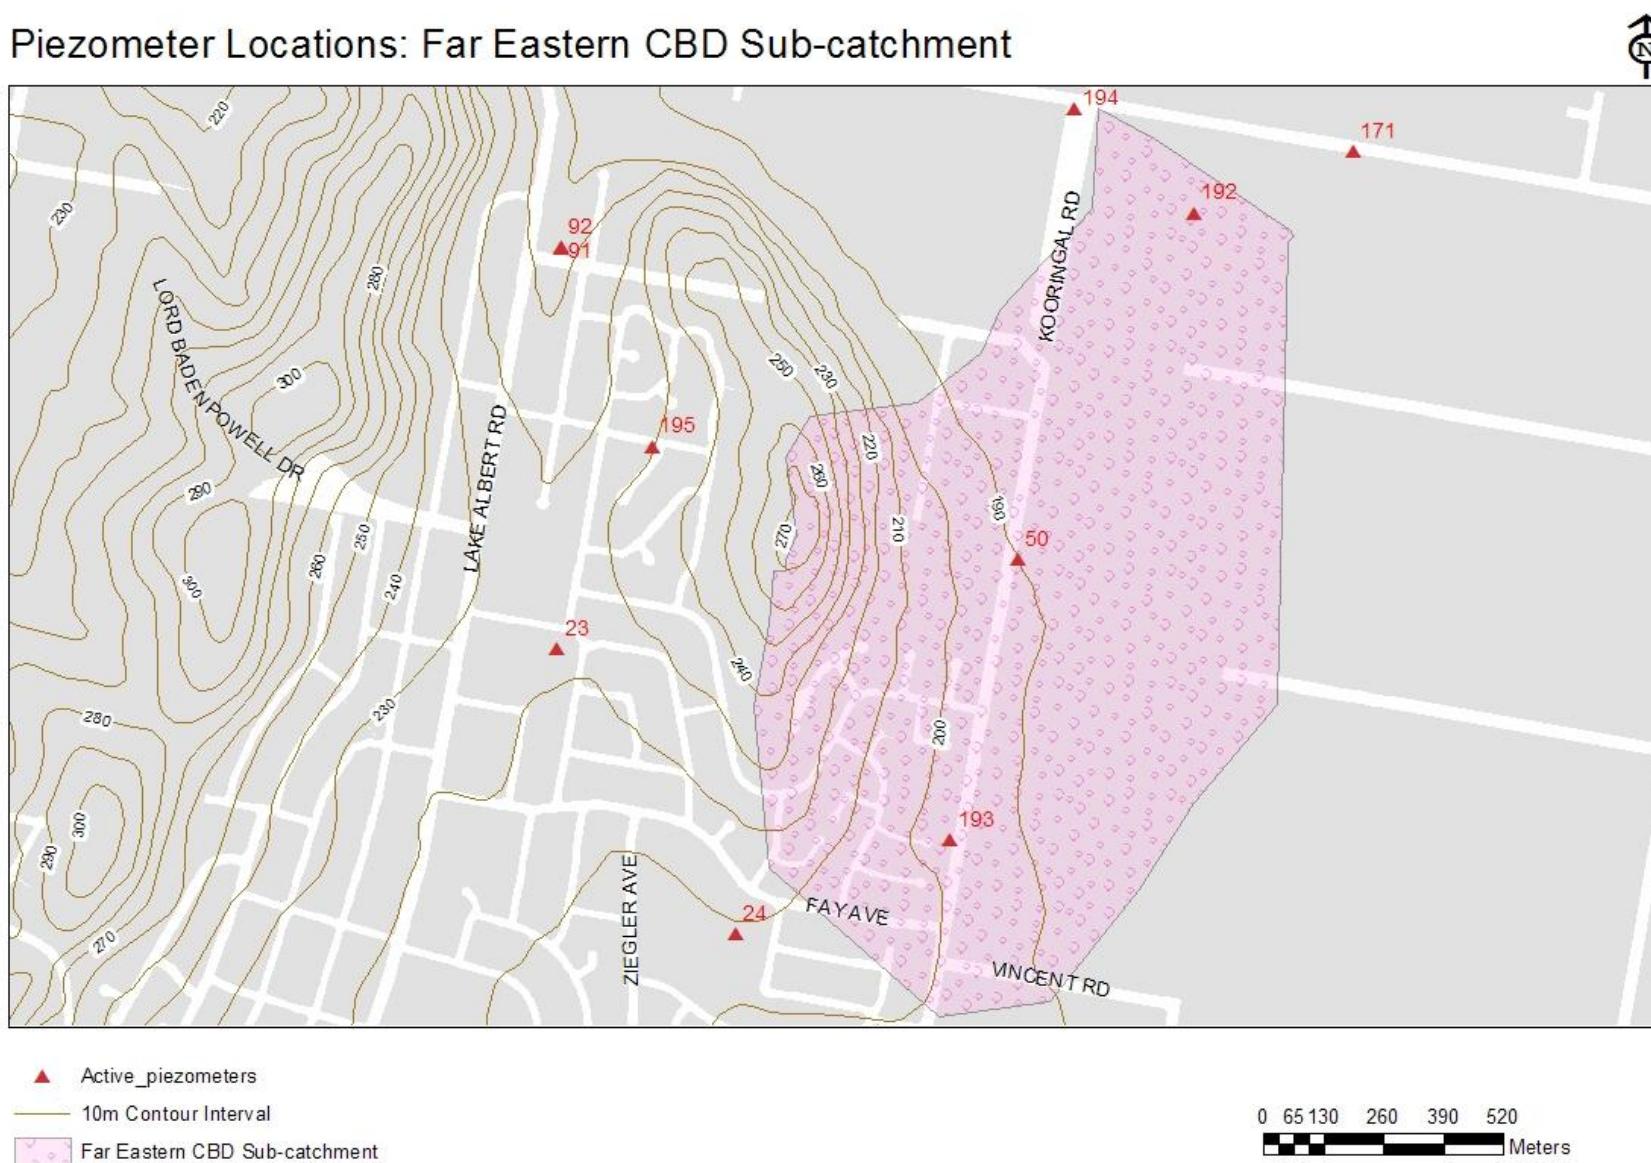


Piezometer Locations: Eastern Sub-catchment

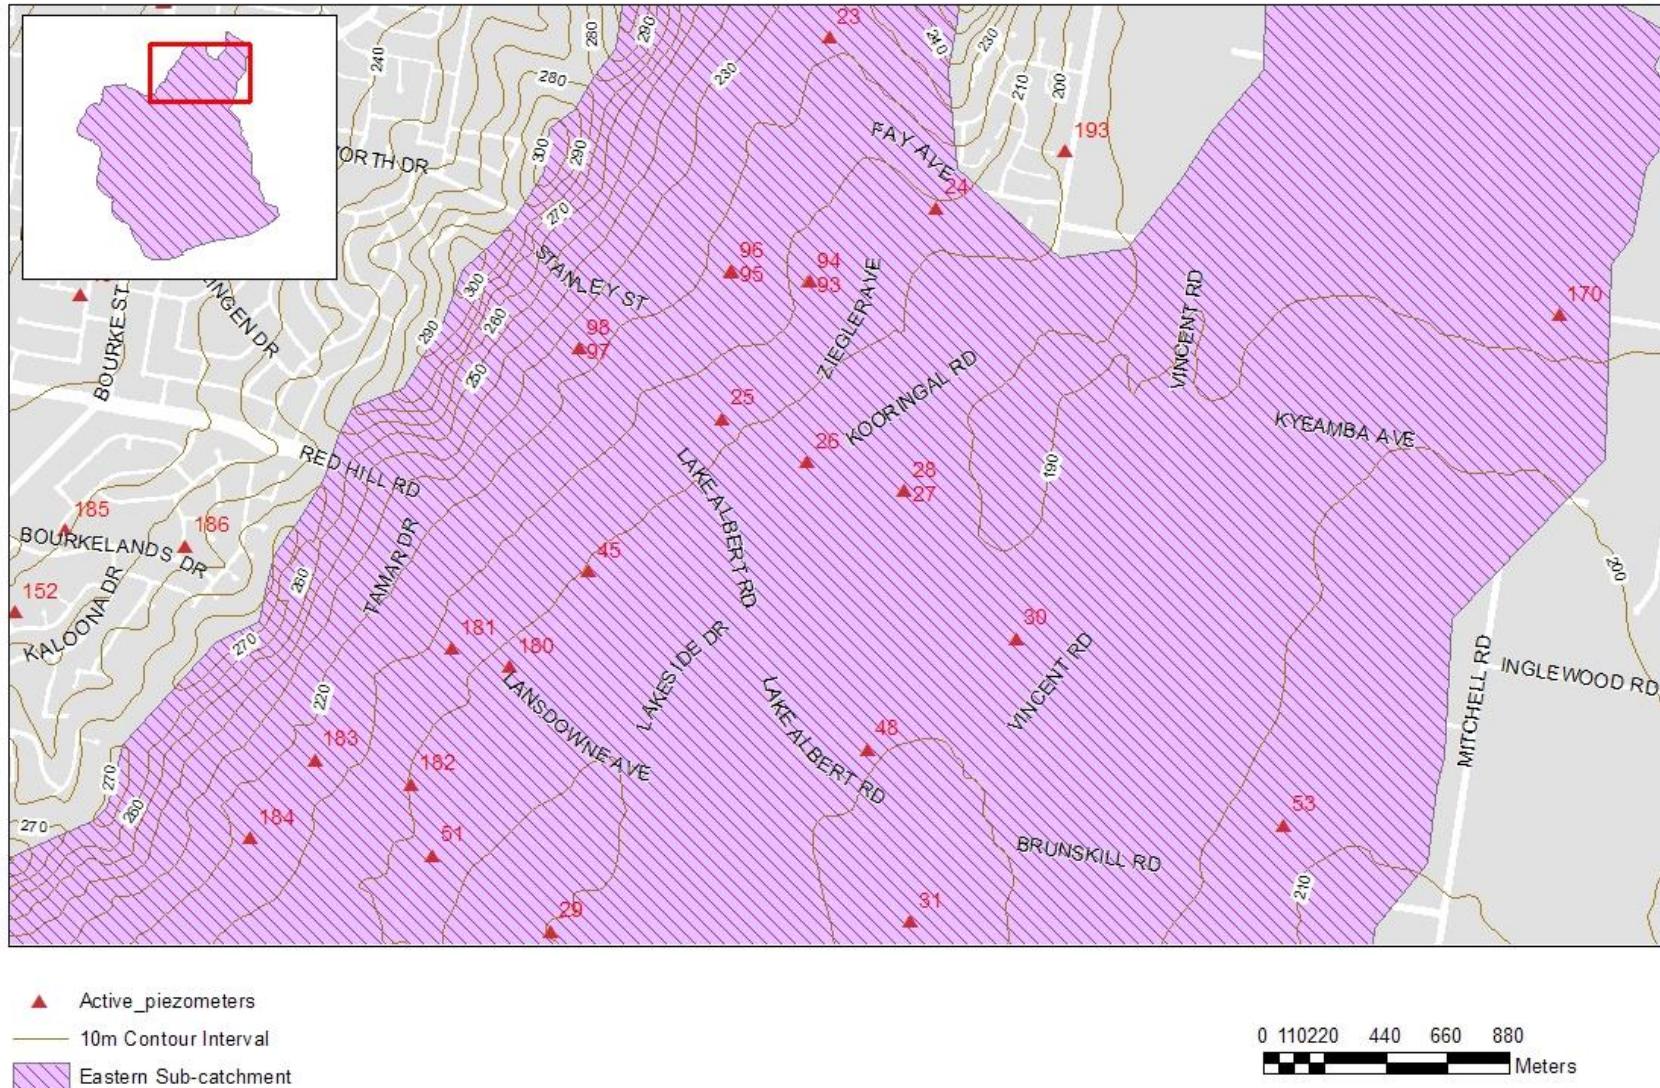


Piezometer Locations: Eastern Sub-catchment

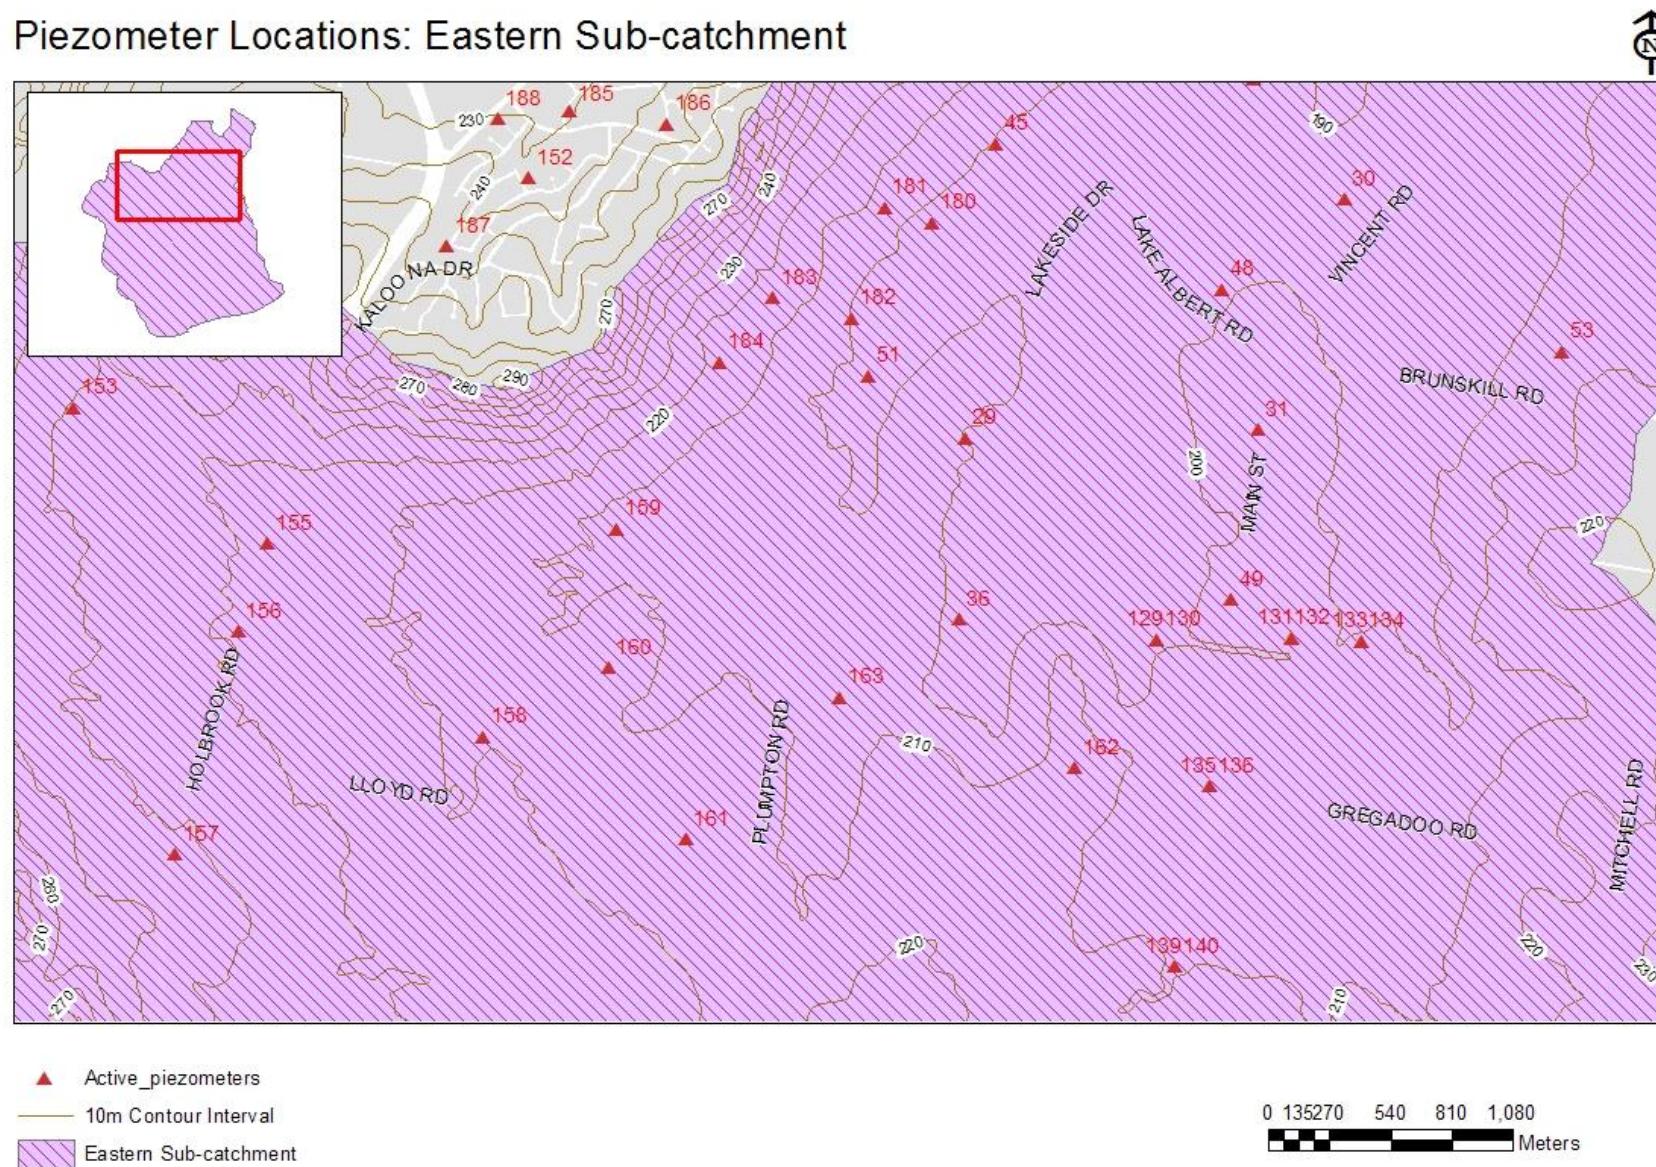


Piezometer Locations: Far Eastern Sub-catchment

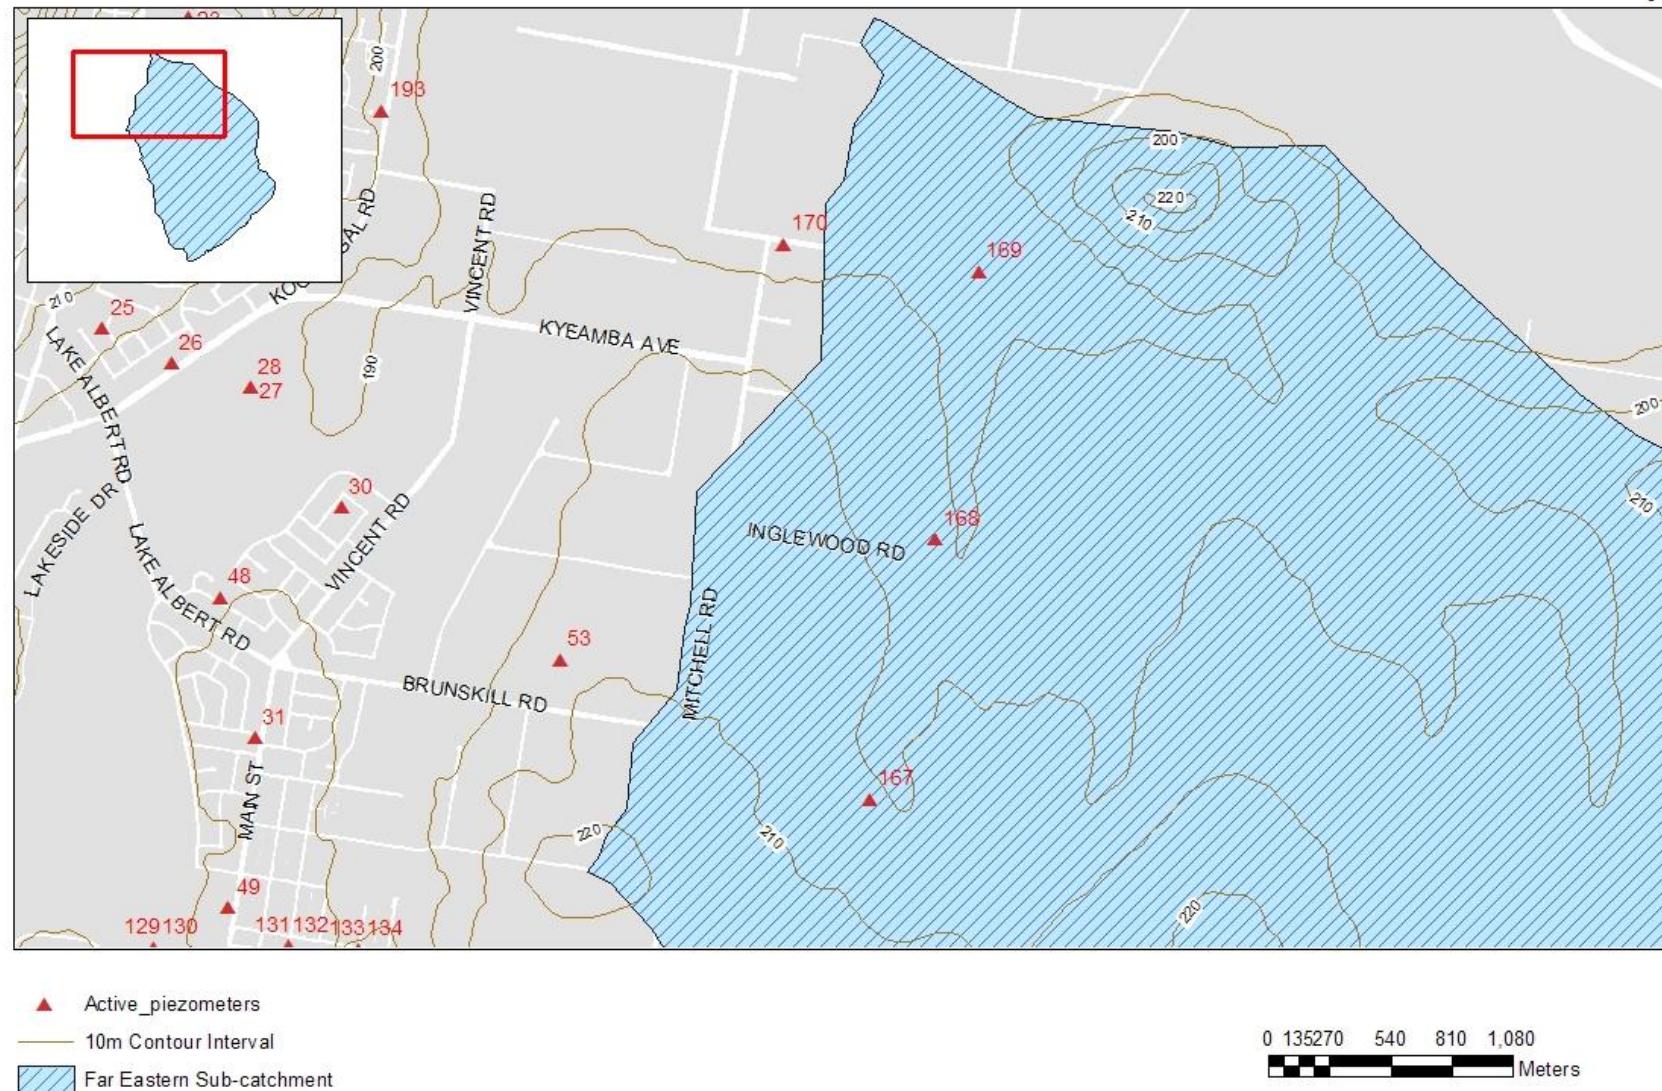


Piezometer Locations: Undefined

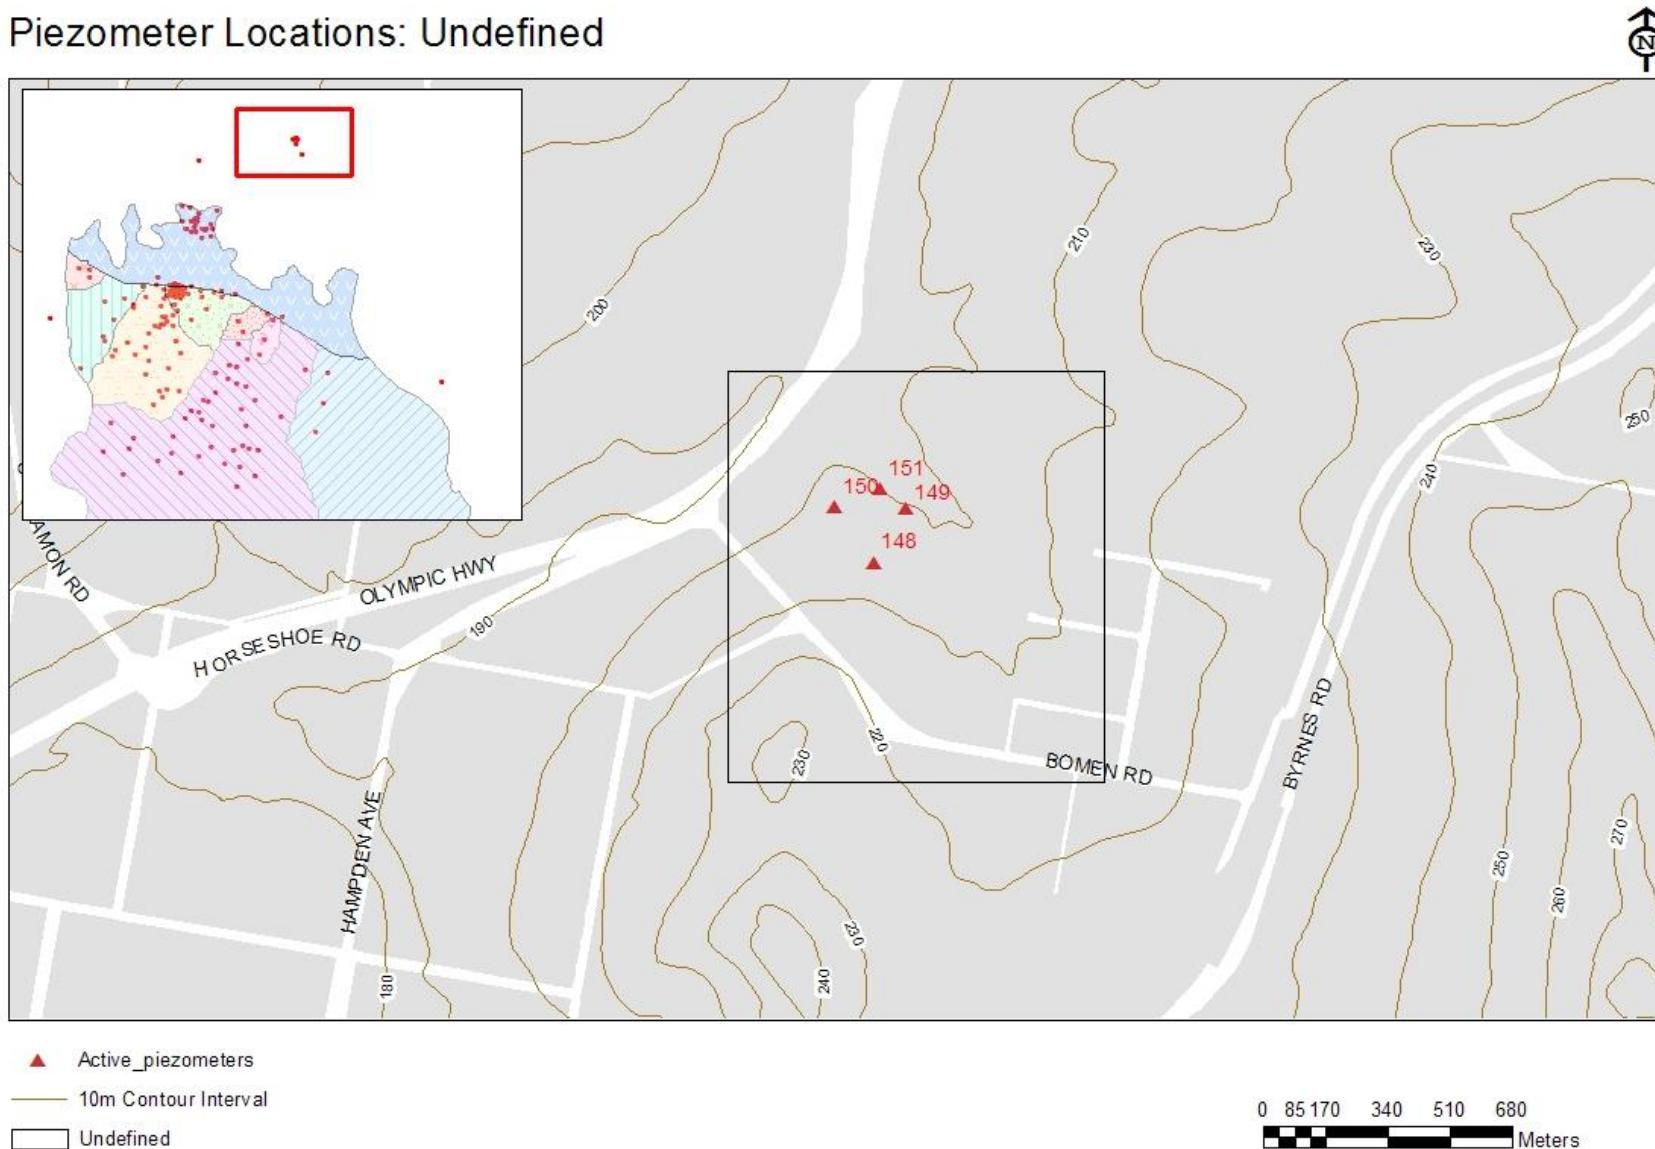

Piezometer Locations: Tarcutta


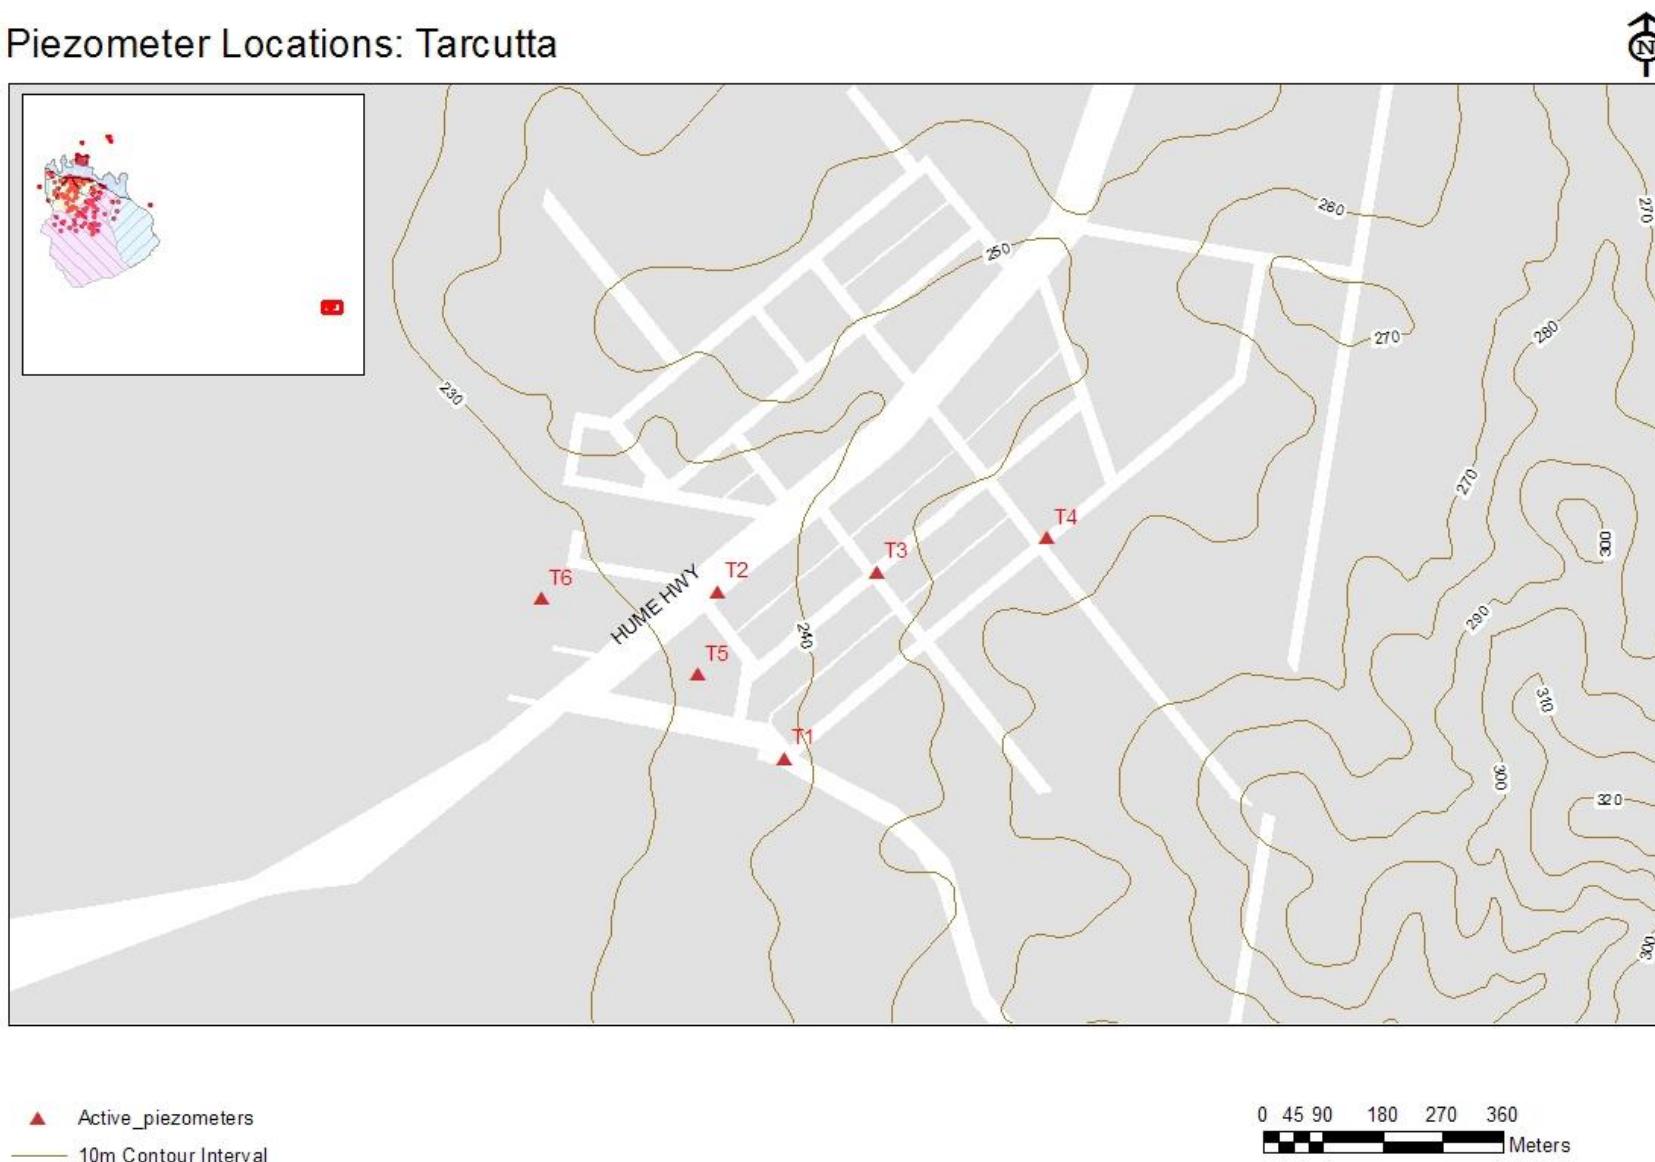


Piezometer Locations: Humula

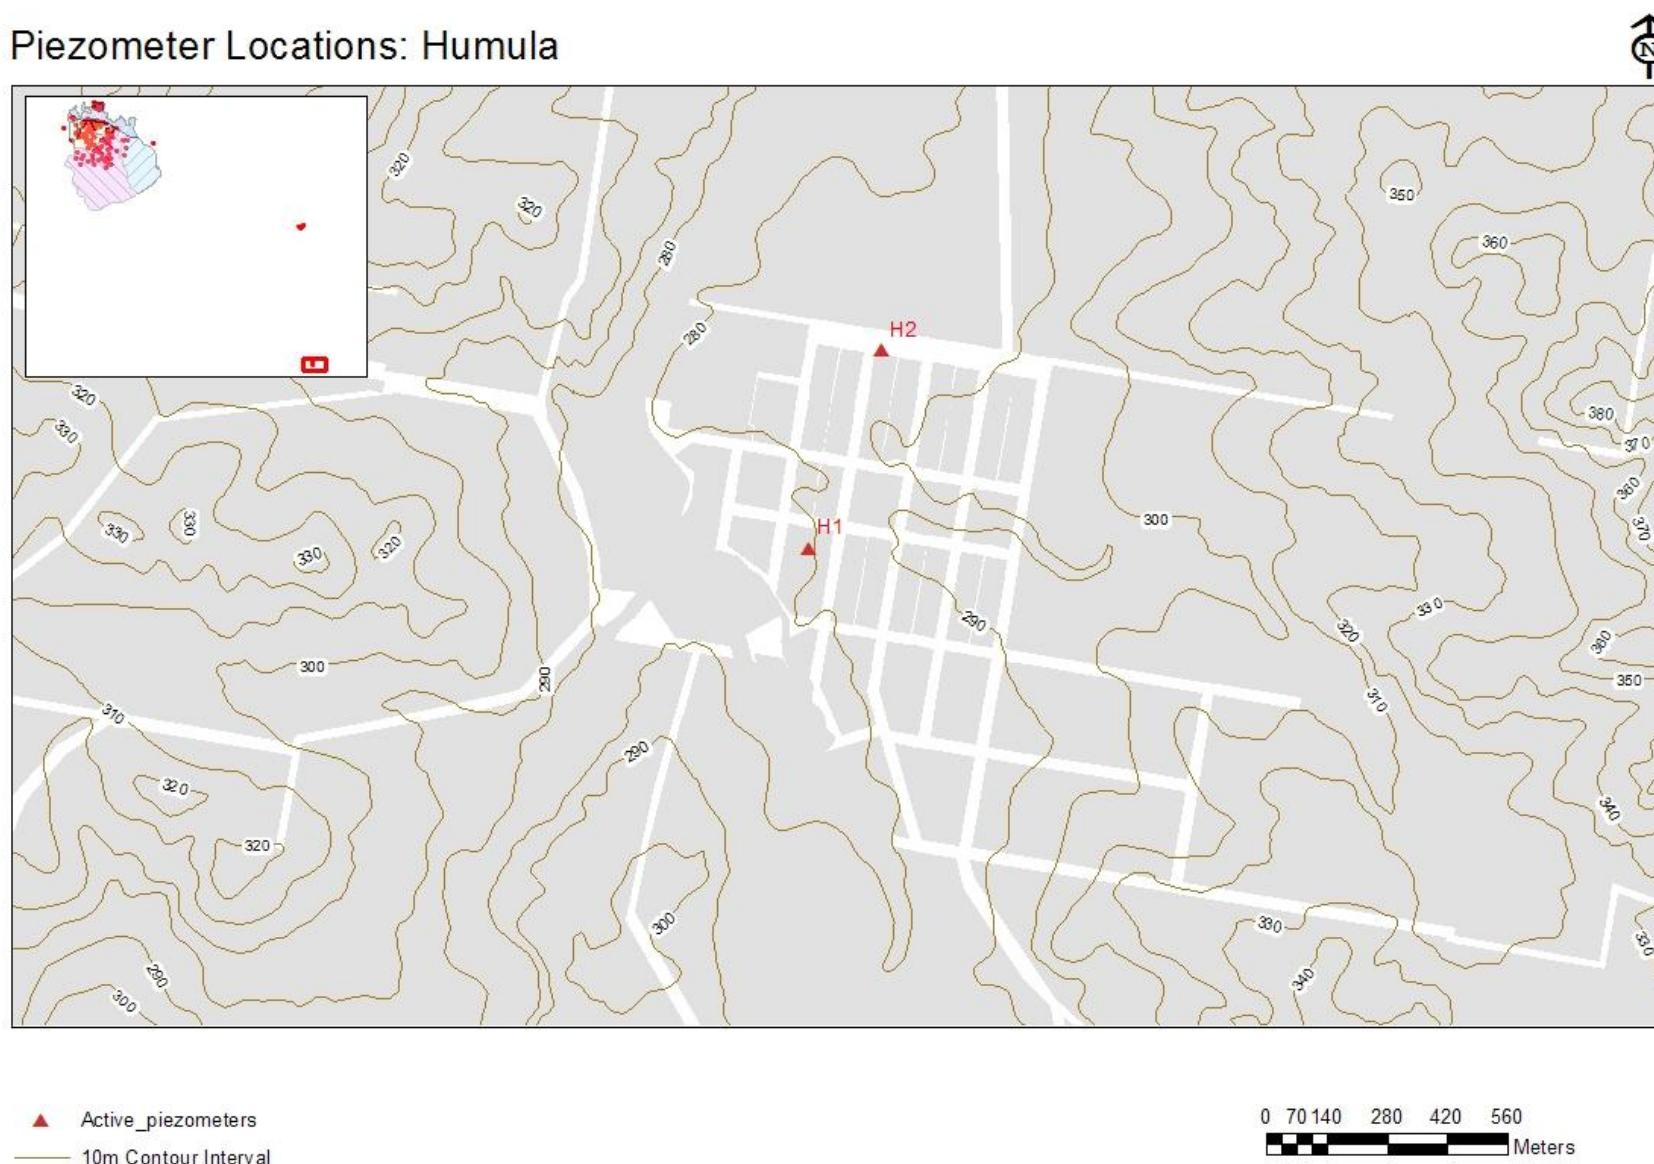

APPENDIX B:
WAGGA WAGGA MAJOR URBAN SUB-CATCHMENTS

Wagga Wagga Major Urban Sub-catchments

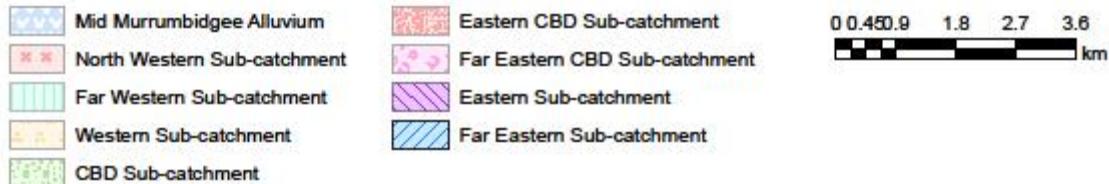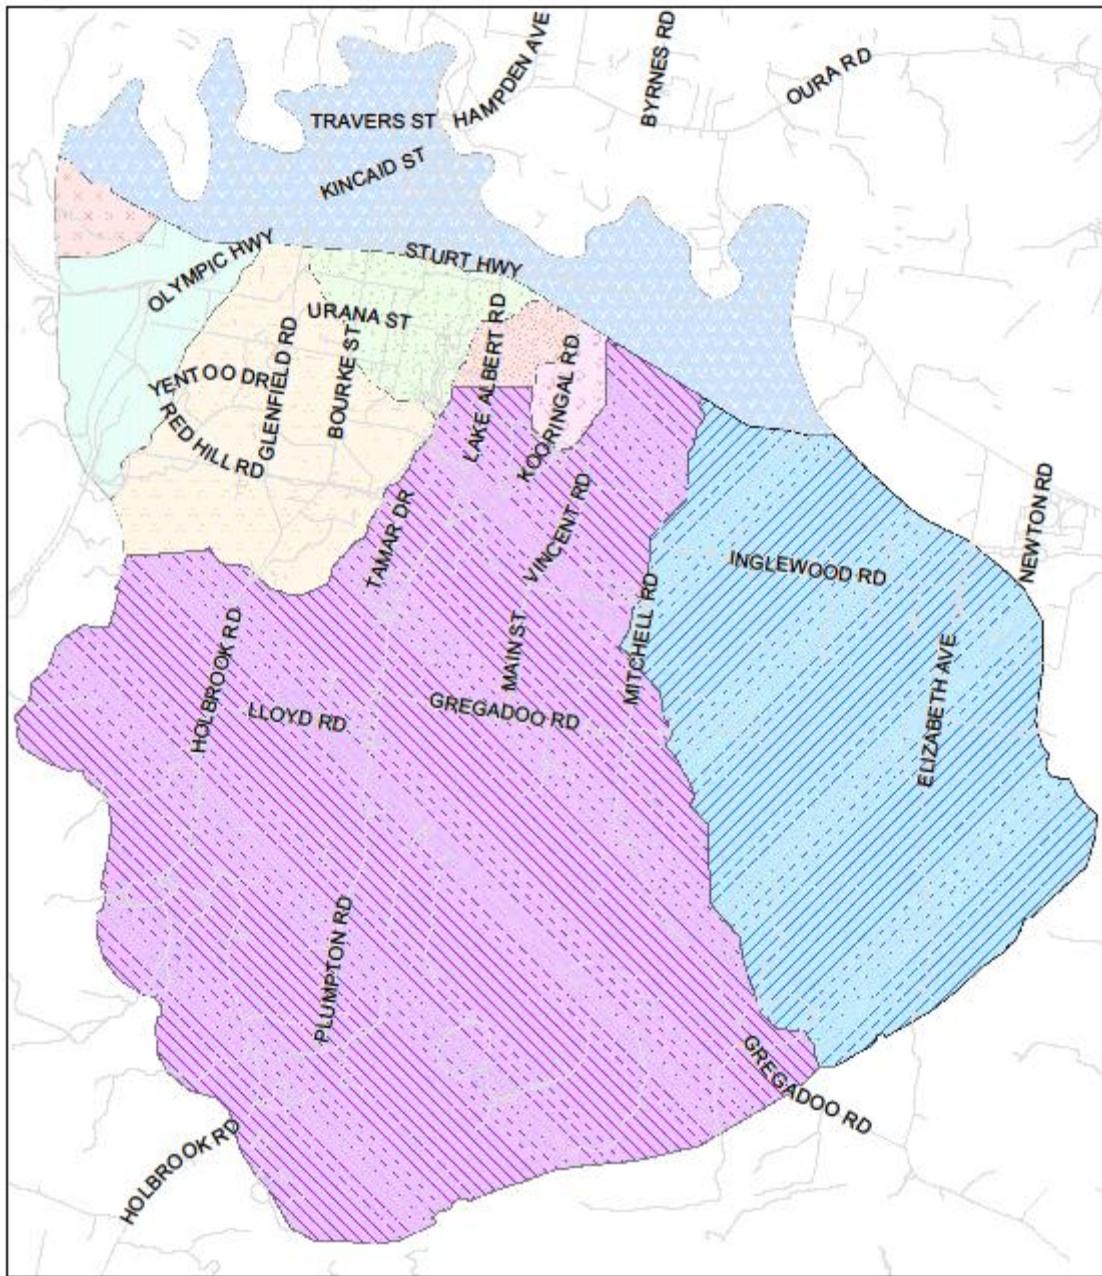

Please note that the 'Undefined' and 'Tarcutta/Humula' piezometer categories are not presented on this map.

**APPENDIX C:
STANDING WATER LEVEL & SALINITY DATA - JULY 2012 TO JUNE 2013**

Piezometer Number	Piezometer Location	Urban Sub catchment	Piezometer Depth	Date Drilled	Average SWL 11/12	Average SWL 12/13	Change In SWL	Average EC 11/12	Average EC 12/13	Change in EC
1	Cnr Moorong St - Sturt Hwy, Central Wagga	MA	10.20	May-94	-7.63	-7.19	0.44	0.70	0.61	-0.09
2	Ashmont Primary School, Ashmont	3	10.30	Jun-94	DRY	DRY	DRY	DRY	DRY	DRY
3	Cheshire St, Central Wagga	3	7.40	May-94	-0.50	DESTROYED		14.68	DESTROYED	
4	Showground arena, Turvey Park		3.30	Mar-94	LOST					
5	Showgrounds, Turvey Park	4	9.70	May-94	-9.92	-9.85	0.07	NETS	NETS	DRY
6	South Campus, Turvey Park	3	13.20	May-94	DRY	DRY	DRY	DRY	DRY	DRY
7	South Campus, Turvey Park	3	3.90	Mar-94	-1.40	-1.41	-0.01	5.22	4.55	-0.68
8	South Campus, Turvey Park		4.20	Mar-94	DESTROYED					
9	South Campus, Turvey Park	3	4.30	Mar-94	0.08	-0.31	-0.39	8.52	9.17	0.65
10	South Campus, Turvey Park	3	4.10	Mar-94	-1.04	-1.16	-0.12	2.33	2.46	0.14
11	3 Dalman Parkway, Glenfield	3	7.10	May-94	-4.35	-2.18	2.17	0.27	0.25	-0.02
12	Kimba Dr, Glenfield	3	14.00	May-94	DRY	DRY	DRY	DRY	DRY	DRY
13	Cnr Glenfield - Red Hill Rds, Lloyd (shallow)	3	8.58	May-94	-6.53	-6.91	-0.38	1.24	1.38	0.14
14	Mt Austin High School, Tolland (shallow)	3	9.90	May-94	DRY	DRY	DRY	DRY	DRY	DRY
15	Mt Austin Public School, Mt Austin (shallow)	3	9.90	May-94	DRY	DRY	DRY	DRY	DRY	DRY
16	Emblen Park, Central Wagga	4	15.10	Jan-95	-13.99	-12.42	1.58	1.52	1.56	0.04
17	Best Park Reserve, Ashmont	3	13.70	Jan-95	-3.02	-2.99	0.03	3.21	3.08	-0.12
18	Nathan Park, Ashmont	2	11.00	Jan-95	-1.03	-1.19	-0.16	9.08	9.08	0.00
19	Turvey Park Public School, Turvey Park	4	17.20	Jan-95	DRY	DRY	DRY	DRY	DRY	DRY
20	Kildare Catholic College, Turvey Park	4	14.90	Jan-95	-11.29	-11.58	-0.29	9.95	10.31	0.36
21	South Wagga Public School, Central Wagga	4	13.00	Jan-95	DRY	-12.19	INC	DRY	NETS	DRY
22	Norman Duck Oval, San Isidore	0	17.00	Mar-95	-16.60	-16.13	0.47	1.99	2.00	0.01
23	Sacred Heart Primary School, Kooringal	7	23.00	Mar-95	-2.65	-3.31	-0.66	0.63	0.58	-0.05
24	Kooringal High School, Kooringal	7	22.00	Mar-95	-11.88	-11.57	0.31	1.80	1.87	0.08
25	Kooringal Public School, Kooringal	7	15.20*	Jun-07*	DRY	DRY	DRY	DRY	DRY	DRY
26	514 Kooringal Rd, Kooringal	7	27.00	Mar-95	-10.13	-9.55	0.58	10.61	10.14	-0.47

Piezometer Number	Piezometer Location	Urban Sub catchment	Piezometer Depth	Date Drilled	Average SWL 11/12	Average SWL 12/13	Change In SWL	Average EC 11/12	Average EC 12/13	Change in EC
27	Kooringal Rd, Kooringal (shallow)	7	13.50	Mar-95	-7.18	-7.07	0.12	12.37	12.77	0.40
28	Kooringal Rd, Kooringal (deep)	7	21.50	Mar-95	-7.23	-7.11	0.12	14.24	15.99	1.75
29	Dalkeith Ave, Lake Albert	7	10.00	Mar-95	-2.44	-2.47	-0.03	5.03	6.16	1.13
30	Croker Park, Lake Albert	7	13.00	Mar-95	-6.16	-6.34	-0.18	0.70	0.68	-0.02
31	Ron Wheeler Park, Lake Albert	7	30.00	Mar-95	-21.46	-21.56	-0.11	2.02	1.97	-0.05
32	Fife St Reserve, Forest Hill	0	16.00	Jul-95	DRY	DRY	DRY	DRY	DRY	DRY
33	Cooramin St, Boorooma	0	18.00	Mar-95	-15.02	-13.73	1.28	NETS	NETS	NETS
34	Mt Austin Public School, Mt Austin (deep)	3	24.00	Jun-95	-9.80	-10.03	-0.23	5.51	5.24	-0.27
35	Emblen Park, Central Wagga		50.00	Jun-95	DESTROYED					
36	Lake Albert foreshore, Lake Albert		11.80	Jan-96	DESTROYED					
37	Kaldari Cres, Glenfield (deep)	3	40.00	May-96	-4.08	-4.12	-0.03	2.75	2.75	-0.01
38	Kaldari Cres, Glenfield (shallow)	3	15.00	May-96	-4.68	-4.79	-0.11	1.50	1.53	0.03
39	Wagga Wagga High School, Turvey Park	4	49.00	May-96	-26.49	-26.81	-0.32	2.36	2.33	-0.02
40	Holy Trinity Primary School, Ashmont	3	25.77	Apr-97	-9.74	-9.91	-0.16	7.37	8.05	0.68
41	Crisp Park, Ashmont	2	16.85	Apr-97	DRY	DRY	DRY	DRY	DRY	DRY
42	Karoom Dr reserve, Glenfield	3	12.60	Apr-97	-1.83	-1.79	0.04	4.77	4.95	0.17
43	Tolland Public School, Tolland	3	9.50*	Jun-07*	-6.53	-5.48	1.06	1.52	1.58	0.06
44	Mt Austin High School, Tolland (deep)	3	22.54	Apr-97	-14.77	-14.67	0.10	6.23	6.08	-0.15
45	Caloola Hostel, Tatton	7	12.89	Apr-97	-10.77	-10.91	-0.13	5.72	5.68	-0.03
46	Wagga Wagga Railway Station, Central Wagga		16.02	Apr-97	DESTROYED					
47	Cnr Red Hill - Glenfield Rds, Lloyd (deep)	3	16.27	Apr-97	-9.14	-8.91	0.23	1.20	1.20	0.00
48	Jack Skeers Park, Lake Albert	7	16.05	Apr-97	-7.11	-6.86	0.26	2.76	2.65	-0.12
49	Lake Albert Public School, Lake Albert	7	26.93	Apr-97	-16.60	-15.15	1.44	1.78	1.63	-0.15
50	Wagga Wagga Christian College, East Wagga	6	19.20	May-97	-17.04	-16.24	0.80	1.46	1.42	-0.04
51	Plumpton Rd, Lake Albert	7	16.70	Apr-97	-9.42	-9.24	0.18	3.13	4.09	0.95
52	39 Dobney Ave, Central Wagga	4	12.60	May-97	-9.35	-8.81	0.54	5.82	6.30	0.48

Piezometer Number	Piezometer Location	Urban Sub catchment	Piezometer Depth	Date Drilled	Average SWL 11/12	Average SWL 12/13	Change In SWL	Average EC 11/12	Average EC 12/13	Change in EC
53	Lawn Cemetery, Lake Albert	7	21.50	Jun-97	-18.69	-15.19	3.50	0.72	0.52	-0.19
54	Derna Pl, Ashmont	2	3.00	Nov-97	-1.47	-1.52	-0.05	12.04	11.20	-0.84
55	1 Clowes Pl, Ashmont	2	3.00	Nov-97	DRY	LOST	DRY	DRY	LOST	DRY
56	6 Saxon St, Central Wagga	3	6.00*	Jun-07*	-5.99	-5.98	0.00	NETS	NETS	NETS
57	7 Mortimer Pl, Central Wagga	3	3.00	Nov-97	-0.60	-0.79	-0.19	13.82	14.26	0.44
58	62 Chaston St, Central Wagga	4	3.00	Nov-97	-0.90	-0.99	-0.09	5.33	5.08	-0.26
59	53-55 Meurant Ave, Central Wagga	4	3.00	Nov-97	-2.88	-2.93	-0.05	NETS	NETS	NETS
60	Opp 16 Cullen Rd, Central Wagga	4	3.00	Nov-97	-2.37	-2.58	-0.21	6.63	7.91	1.28
61	Opp 38 Cullen Rd, Central Wagga	4	3.00	Nov-97	-2.77	-2.86	-0.09	NETS	NETS	NETS
62	59 Gormly Ave, Central Wagga	MA	3.00	Nov-97	DRY	DRY	DRY	DRY	DRY	DRY
63	Emblen Park, Central Wagga	4	3.00	Nov-97	DRY	DRY	DRY	DRY	DRY	DRY
64	11 Sullivan St, Central Wagga	4	3.00	Nov-97	-2.94	-2.72	0.22	NETS	NETS	NETS
65	40 Meurant Ave, Central Wagga	4	3.00	Nov-97	-2.21	-2.52	-0.31	2.89	NETS	DEC
66	18 Chaston St, Central Wagga	4	3.00	Nov-97	-1.05	-1.16	-0.11	4.91	4.63	-0.28
67	Meurant Ave, Central Wagga	4	6.00*	Jun-07*	-5.95	DRY	DEC	NETS	DRY	DRY
68	11 Lewisham Ave, Central Wagga	4	3.00	Nov-97	DRY	DRY	DRY	DRY	DRY	DRY
69	19 Hardy Ave, Central Wagga	4	3.00	Nov-97	DRY	DRY	DRY	DRY	DRY	DRY
70	33 Gormly Ave, Central Wagga	4	1.70	Nov-97	DRY	DRY	DRY	DRY	DRY	DRY
71	1 Roma St, Central Wagga	4	9.00*	Jun-08*	-3.99	-5.25	-1.27	1.20	1.13	-0.07
72	9 Brookong Ave, Central Wagga	MA	3.00	Nov-97	DRY	DRY	DRY	DRY	DRY	DRY
73	Wagga Wagga Base Hospital, Central Wagga	MA	3.00	Nov-97	DRY	DRY	DRY	DRY	DRY	DRY
74	Edward St, Central Wagga	MA	3.00	Nov-97	DRY	DRY	DRY	DRY	DRY	DRY
75	6 Edward St, Central Wagga	MA	3.00	Nov-97	DRY	DRY	DRY	DRY	DRY	DRY
76	332-334 Edward St, Central Wagga	MA	3.00	Nov-97	DRY	DRY	DRY	DRY	DRY	DRY
77	312 Edward St, Central Wagga		3.00	Nov-97	DESTROYED					
78	2 Dobney Ave, Central Wagga	MA	3.00	Nov-97	DRY	DRY	DRY	DRY	DRY	DRY

Piezometer Number	Piezometer Location	Urban Sub catchment	Piezometer Depth	Date Drilled	Average SWL 11/12	Average SWL 12/13	Change In SWL	Average EC 11/12	Average EC 12/13	Change in EC
79	Gormly-Emblen Sts roundabout, Central Wagga	MA	4.40	Sep-98	DRY	DRY	DRY	DRY	DRY	DRY
80	Gormly-Harrison Sts roundabout, Central Wagga	4	6.00	Sep-98	-2.64	-3.37	-0.73	2.26	1.62	-0.64
81	48 Docker St, Central Wagga	MA	6.80	Sep-98	-4.73	-5.35	-0.62	1.23	1.14	-0.09
82	27 Hardy Ave, Central Wagga	4	2.60	Sep-98	DRY	DRY	DRY	DRY	DRY	DRY
83	57 Hardy Ave, Central Wagga	4	5.20*	Jun-07*	-5.06	-5.05	0.01	NETS	NETS	NETS
84	2 Sullivan Ave, Central Wagga	4	3.40	Sep-98	-4.05	DRY	DEC	NETS	DRY	DRY
85	27 Meurant Ave, Central Wagga	4	4.80*	Sep-98	DRY	DRY	DRY	DRY	DRY	DRY
86	2 Lewisham Ave, Central Wagga	4	7.50	Sep-98	-4.57	-5.40	-0.83	1.71	1.75	0.04
87	12 Meurant Ave, Central Wagga	4	5.20	Sep-98	-4.36	DRY	DEC	4.28	DRY	DEC
88	2 Chaston St, Central Wagga	4	10.00*	May-07*	-4.80	-6.33	-1.53	19.41	20.73	1.32
89	31 Chaston St, Central Wagga	4	5.50	Sep-98	-2.33	-3.32	-0.99	13.61	12.06	-1.55
90	51 Chaston St, Central Wagga	4	6.60	Sep-98	-1.75	-2.11	-0.36	7.66	8.91	1.25
91	Mount St, Kooringal (shallow)	5	10.60	Jun-99	-1.02	-1.18	-0.16	1.09	1.19	0.10
92	Mount St, Kooringal (deep)	5	27.70	Jun-99	-0.94	-1.16	-0.22	0.95	0.96	0.01
93	Henwood Park, Kooringal (shallow)	7	13.60	Jun-99	DRY	DRY	DRY	DRY	DRY	DRY
94	Henwood Park, Kooringal (deep)	7	29.90	Jun-99	-15.32	-14.75	0.57	1.34	1.34	0.00
95	Henwood Park, Kooringal (shallow)	7	7.90	Jun-99	DRY	DRY	DRY	DRY	DRY	DRY
96	Henwood Park, Kooringal (deep)	7	66.00	Jun-99	-24.15	-23.23	0.91	1.08	1.06	-0.02
97	Opp 22 Amaroo St, Kooringal (shallow)	7	9.30	Jul-99	DRY	DRY	DRY	DRY	DRY	DRY
98	Opp 22 Amaroo St, Kooringal (deep)	7	83.00	Jul-99	-50.11	-48.84	1.27	1.42	1.44	0.01
99	29 Hardy Ave, Central Wagga	4	15.00	Mar-01	-15.42	DRY	DEC	NETS	NETS	NETS
100	29 Hardy Ave, Central Wagga	4	31.00	Mar-01	-19.40	-19.69	-0.30	1.10	1.10	0.00
101	29 Hardy Ave, Central Wagga	4	60.00	Mar-01	-19.22	-19.53	-0.31	0.99	1.01	0.02
102	Cnr Meurant St - Lewisham Ave, Central Wagga	4	15.00	Mar-01	-10.73	-11.37	-0.64	12.59	14.14	1.55
103	Cnr Meurant St - Lewisham Ave, Central Wagga	4	31.50	Mar-01	-20.03	-20.57	-0.55	3.03	2.66	-0.37
104	Cnr Meurant St - Lewisham Ave, Central Wagga	4	61.00	Mar-01	-19.95	-20.39	-0.44	5.84	4.82	-1.02

Piezometer Number	Piezometer Location	Urban Sub catchment	Piezometer Depth	Date Drilled	Average SWL 11/12	Average SWL 12/13	Change In SWL	Average EC 11/12	Average EC 12/13	Change in EC
105	Narrung St, Wiradjuri (shallow)	MA	8.09	May-94	-4.48	DRY	DEC	0.26	DRY	DEC
106	Narrung St, Wiradjuri (deep)	MA	17.88	Mar-99	-7.05	-7.41	-0.36	0.22	0.18	-0.04
107	Narrung St STW, Wiradjuri (shallow)	MA	8.13	May-94	-6.56	-6.23	0.33	1.59	1.94	0.34
108	Narrung St STW, Wiradjuri (deep)	MA	16.00	Mar-99	-6.45	-3.20	3.25	0.34	0.33	-0.01
109	Narrung St STW, Wiradjuri (shallow)	MA	7.80	May-94	-6.17	-5.71	0.45	0.34	0.33	-0.01
110	Narrung St STW, Wiradjuri (deep)	MA	11.49	Mar-99	-5.96	-5.80	0.16	0.37	0.32	-0.05
111	Narrung St STW, Wiradjuri	MA	7.75	May-94	DRY	DRY	DRY	DRY	DRY	DRY
112	Narrung St STW, Wiradjuri	MA	6.58	May-94	DRY	DRY	DRY	DRY	DRY	DRY
113	Narrung St STW, Wiradjuri (shallow)	MA	7.87	May-94	-4.03	-6.61	-2.58	0.28	0.15	-0.14
114	Narrung St STW, Wiradjuri (deep)	MA	16.39	Mar-99	-6.84	-7.37	-0.53	0.74	2.40	1.66
115	Narrung St liquid waste cell, Wiradjuri	MA	10.20	Jan-95	-8.61	DESTROYED	2.83	DESTROYED		
116	Narrung St liquid waste cell, Wiradjuri	MA	15.78	Mar-99	-7.46	-7.85	-0.39	0.99	0.93	-0.06
117	Billaghah St, Wiradjuri		6.22	Jan-95	DESTROYED					
118	Billaghah St, Wiradjuri	MA	15.96	Mar-99	-6.60	-6.89	-0.29	0.80	0.65	-0.15
119	Narrung St sweeper waste dump, Wiradjuri		9.60	May-94	DESTROYED					
120	Narrung St sweeper waste dump, Wiradjuri	MA	16.07	Mar-99	-7.67	-8.12	-0.45	0.81	0.86	0.05
121	Narrung St, Wiradjuri	MA	16.09	Mar-99	-7.33	-7.42	-0.10	NA	NA	NA
122	59 Galing Pl, Wiradjuri	MA	19.38	Aug-01	-9.35	-9.28	0.07	1.96	3.04	1.08
123	33 Galing Pl, Wiradjuri	MA	17.48	Aug-01	-8.74	-8.84	-0.10	1.90	2.17	0.27
124	Wiradjuri Cres, Wiradjuri	MA	16.39	Aug-01	-8.59	-8.29	0.30	1.60	1.73	0.13
125	Cnr Narrung St - Wiradjuri Reserve, Wiradjuri	MA	18.39	Aug-01	-8.09	-8.27	-0.18	0.36	0.36	0.00
126	Billaghah St, Wiradjuri	MA	19.13	Aug-01	-8.00	-8.18	-0.18	0.59	0.17	-0.41
127	Toll Group, Wiradjuri	MA	13.78	Aug-01	-8.12	-8.91	-0.79	0.37	0.26	-0.10
128	9 College Ave, Turvey Park	3	10.20*	May-07*	-6.52	-6.94	-0.42	2.20	2.25	0.05
129	Lakehaven Dr, Lake Albert (shallow)	7	5.91	Oct-92	DRY	DRY	DRY	DRY	DRY	DRY
130	Lakehaven Dr, Lake Albert (deep)	7	15.00*	May-07*	-12.76	-12.58	0.18	9.92	8.60	-1.32

Piezometer Number	Piezometer Location	Urban Sub catchment	Piezometer Depth	Date Drilled	Average SWL 11/12	Average SWL 12/13	Change In SWL	Average EC 11/12	Average EC 12/13	Change in EC
131	Cnr Craft - Graham Sts, Lake Albert (shallow)	7	5.13	Oct-92	DRY	DRY	DRY	DRY	DRY	DRY
132	Cnr Craft - Graham Sts, Lake Albert (deep)	7	12.30	Oct-92	-7.70	-7.37	0.33	3.37	3.33	-0.04
133	Cnr Craft - Bouquet Sts, Lake Albert (shallow)	7	5.84	Oct-92	DRY	DRY	DRY	DRY	DRY	DRY
134	Cnr Craft - Bouquet Sts, Lake Albert (deep)	7	11.96	Oct-92	DRY	DRY	DRY	DRY	DRY	DRY
135	Cnr Main St - Gregadoo Rd, Lake Albert (shallow)	7	5.04	Oct-92	-4.47	-4.22	0.25	0.30	0.16	-0.14
136	Cnr Main St - Gregadoo Rd, Lake Albert (deep)	7	12.01	Oct-92	DRY	DRY	DRY	DRY	DRY	DRY
137	10 Gregadoo Rd, Lake Albert (shallow)		4.70	Oct-92	DESTROYED					
138	10 Gregadoo Rd, Lake Albert (deep)		12.20	Oct-92	DESTROYED					
139	Redbank Rd, Lake Albert (shallow)	7	5.87	Oct-92	-3.77	-4.43	-0.65	1.29	0.66	-0.63
140	Redbank Rd, Lake Albert (deep)	7	12.40	Oct-92	-11.71	-11.19	0.52	NETS	8.42	INC
141	Travelling stock reserve, Bomen		16.04	Jun-00	DESTROYED					
142	Red Hill Rd, Glenfield	3	25.60	Apr-02	-20.70	-20.16	0.54	NA	NA	NA
143	6930 Olympic Hwy, Kapooka	2	42.00	Apr-02	DRY	DRY	DRY	DRY	DRY	DRY
144	Cnr Narrung - Billagha Sts, Wiradjuri	MA	15.50	Nov-06	-6.95	-6.90	0.04	0.95	0.92	-0.02
145	Wiradjuri Reserve, Wiradjuri	MA	14.00	Nov-06	-5.67	-5.74	-0.07	0.27	0.31	0.03
146	Orana Pl, Wiradjuri	MA	19.50	Nov-06	-8.88	-8.53	0.35	1.43	1.15	-0.27
147	South Campus, Turvey Park	3	3.30	unknown	-0.55	-0.81	-0.26	16.69	16.93	0.24
148	Bomen Industrial Sewage Treatment Facility	0	13.20	unknown	-4.07	-4.34	-0.27	1.54	2.14	0.61
149	BISTF, Bomen	0	14.20	unknown	0.38	0.38	0.00	2.80	2.64	-0.15
150	BISTF, Bomen	0	13.10	unknown	-3.06	-3.16	-0.10	0.96	1.06	0.10
151	BISTF, Bomen	0	unknown	unknown	-0.91	-1.07	-0.16	2.70	3.21	0.51
152	1 Bedervale St, Bourkelands	3	14.70	Jun-07	-11.40	-9.34	2.06	1.80	1.62	-0.18
153	Cnr Burgan - Indigo Dr, Glenoak	7	15.00	May-07	-11.15	-10.83	0.32	4.87	4.87	0.00
154	19 Mirbelia Dr, Glenoak	7	13.00	Jun-07	-4.47	-4.45	0.02	0.53	0.49	-0.04
155	Cnr Indigo Dr - Holbrook Rd, Springvale	7	10.20	Jun-07	-7.64	-8.19	-0.56	0.72	0.84	0.12
156	Cnr Mirbelia Dr - Holbrook Rd, Springvale	7	15.20	Jun-07	DRY	DRY	DRY	DRY	DRY	DRY

Piezometer Number	Piezometer Location	Urban Sub catchment	Piezometer Depth	Date Drilled	Average SWL 11/12	Average SWL 12/13	Change In SWL	Average EC 11/12	Average EC 12/13	Change in EC
157	Holbrook Rd, Springvale	7	15.00	May-07	-9.06	-9.89	-0.83	4.25	3.89	-0.36
158	Stringybark Pl, Springvale	7	15.00	Jun-07	DRY	DRY	DRY	DRY	DRY	DRY
159	6 Yarran Pl, Springvale	7	10.00	May-07	-3.86	-4.40	-0.54	0.49	0.98	0.49
160	3 Mallee Rd, Springvale	7	15.30	Jun-07	DRY	DRY	DRY	DRY	DRY	DRY
161	1 Lloyd Rd, Springvale	7	8.60	May-07	-2.51	-2.65	-0.14	4.19	4.09	-0.09
162	39 Gregadoo Rd, Lake Albert	7	9.00	May-07	-5.24	-5.33	-0.09	3.38	3.52	0.14
163	Stringybark Creek Wetland, Gregadoo Rd, L.A	7	8.50	unknown	DRY	DRY	DRY	DRY	DRY	DRY
164	Adjacent to Murrumbidgee River, Narrung Street	MA	20.00	Dec-07	-8.05	-8.01	0.04	0.18	NA	NA
165	Travers St at entrance of Narrung St, Wiradjuri	MA	13.00	Dec-07	-8.87	-8.62	0.25	NA	NA	NA
166	Travers St behind 10 Incarnie Cres, Wiradjuri	MA	14.80	Dec-07	-9.33	-8.86	0.48	0.48	0.59	0.10
167	56 Cummins Road, Lake Albert	8	11.00	Jun-08	DRY	DRY	DRY	DRY	DRY	DRY
168	378 Bakers Ln., Lake Albert	8	13.50	Jun-08	-9.78	-8.33	1.45	2.59	2.43	-0.16
169	334 Bakers Ln., Lake Albert	8	13.50	Jun-08	-6.86	-5.94	0.93	10.53	10.35	-0.18
170	1 Mitchell Road, Lake Albert	7	13.00	Jun-08	-11.94	-11.53	0.41	3.82	4.34	0.52
171	124-156 Copland street, East Wagga Wagga	MA	8.50	Jun-08	DRY	DRY	DRY	DRY	DRY	DRY
172	Rear of 5-6 Kenny Place, Tolland		9.50	Jun-08	DESTROYED					
173	Rear of 28 Bandera Avenue, Glenfield Park	3	8.00	Jun-08	DRY	DRY	DRY	DRY	DRY	DRY
174	Rear of 48 Paldi Cres, Glenfield Park	2	14.00	Jun-08	-9.70	-8.84	0.86	11.43	9.47	-1.95
175	Rear of 12 Birri Place, Glenfield Park	2	15.00	Jun-08	-7.66	-7.32	0.34	2.26	2.23	-0.04
176	39 Meurant Avenue (on Emblem Street)	4	9.00	Jun-08	-7.87	DRY	DEC	12.28	DRY	DEC
177	47 Gormly Avenue (on Emblem St)	MA	5.50	Jun-08	DRY	DRY	DRY	DRY	DRY	DRY
178	Anderson Oval, Tolland	3	7.30	Jun-10	-3.66	-4.00	-0.33	0.85	1.60	0.75
179	Anderson Oval, Tolland	3	7.50	Jun-10	-0.43	-0.56	-0.13	4.09	4.99	0.90
180	Plumpton Rd, Tatton	7	6.80	Jun-10	DRY	DRY	DRY	DRY	DRY	DRY
181	Kimberley Dr, Tatton	7	10.00	Jun-10	-8.43	-8.29	0.14	6.66	6.78	0.12
182	2 Stirling Blvd, Tatton	7	12.00	Jun-10	-2.48	-2.84	-0.37	1.00	1.49	0.48

Piezometer Number	Piezometer Location	Urban Sub catchment	Piezometer Depth	Date Drilled	Average SWL 11/12	Average SWL 12/13	Change In SWL	Average EC 11/12	Average EC 12/13	Change in EC
183	46 Stirling Blvd, Tatton	7	11.70	Jun-10	-11.31	-11.09	0.22	7.86	7.75	-0.12
184	72 Stirling Blvd, Tatton	7	5.80	Jun-10	DRY	DRY	DRY	DRY	DRY	DRY
185	43A Berembee St, Bourkelands	3	6.30	Jun-10	DRY	DRY	DRY	DRY	DRY	DRY
186	Wilgoma St, Bourkelands	3	8.60	Jun-10	-2.74	-3.16	-0.42	0.88	0.83	-0.05
187	Yarrawah Cres, Bourkelands	3	9.00	Jun-10	-2.10	-2.46	-0.36	0.72	0.71	-0.01
188	Audervale Cl, Bourkelands	3	5.00	Jun-10	-2.90	-2.87	0.03	0.68	0.74	0.06
189	46 Riverview Dr, Riverview	1	5.70	Jun-10	-2.38	-3.10	-0.72	0.66	0.98	0.31
190	Roach Rd, Riverview	1	9.20	25-Jun-10	-5.86	-5.79	0.06	4.82	4.83	0.01
191	110 Riverview Dr, Riverview	1	5.00	25-Jun-10	-3.36	-3.87	-0.51	0.36	0.32	-0.04
192	Exhibition Centre, East Wagga Wagga	6	10.50	27-Jun-10	-9.72	-8.87	0.85	1.14	1.34	0.20
193	Kooringal Rd, Kooringal	6	8.00	21-Jun-10	DRY	DRY	DRY	DRY	DRY	DRY
194	Copeland St, East Wagga Wagga		12.00	22-Jun-10	DESTROYED					
195	Macintosh Place, Kooringal	5	6.00	23-Jun-10	DRY	DRY	DRY	DRY	DRY	DRY
196	Showground, Central Wagga	4	14.60	26-Jun-10	-3.57	-4.54	-0.97	1.50	1.78	0.28
197	South west of quarry, Lloyd	3	25.00	Jul-12	NEW	DRY	NEW	DRY	DRY	NEW
198	Adjacent creek bed, Lloyd	3	25.00	Jul-12	NEW	-24.67	NEW	NETS	NETS	NEW
199	West of farm house, Lloyd	3	25.00	Jul-12	NEW	DRY	NEW	DRY	DRY	NEW
200	Transmission line, Lloyd	3	25.00	Jul-12	NEW	DRY	NEW	DRY	DRY	NEW
201	Wiradjuri track, Silverlite Reserve, Lloyd	3	25.00	Jul-12	NEW	-24.87	NEW	NETS	NETS	NEW
202	Cnr Yentoo Dr - Red Hill Rd, Lloyd	3	25.00	Jul-12	NEW	-18.87	NEW	NEW	NEW	NEW
203	West of cnr Dalman Pk - Red Hill Rd, Lloyd	3	25.00	Jul-12	NEW	-22.63	NEW	NETS	NETS	NEW
204	East of cnr Dalman Pk - Red Hill Rd, Lloyd	3	25.00	Jul-12	NEW	-17.16	NEW	4.67	4.67	NEW
205	Rear Barton Ave (north), Lloyd	3	25.00	Jul-12	NEW	-17.70	NEW	10.34	10.34	NEW
206	Rear Barton Ave (south), Lloyd	3	25.00	Jul-12	NEW	-15.29	NEW	0.40	0.40	NEW
207	Quarry entrance, Lloyd	3	24.00	Jul-12	NEW	DRY	NEW	DRY	DRY	NEW
208	Rear 33 Barrima Dr, Glenfield Park	3	7.50	Jun-13	NEW	-1.48	NEW	NEW	NEW	NEW

Piezometer Number	Piezometer Location	Urban Sub catchment	Piezometer Depth	Date Drilled	Average SWL 11/12	Average SWL 12/13	Change In SWL	Average EC 11/12	Average EC 12/13	Change in EC
209	4 Mima St, Glenfield Park	3	5.00	Jun-13	NEW	-2.37	NEW	NEW	NEW	NEW
210	Duke of Kent Oval, Central Wagga	1	8.75	Jun-13	NEW	DRY	NEW	DRY	DRY	NEW
1/1	Emblen Park, Central Wagga	4	15.00	Unknown	-13.34	-12.62	0.73	2.08	2.36	0.28
1/2	Emblen Park, Central Wagga	4	30	Unknown	-21.84	-19.23	2.61	1.78	1.82	0.04
1/3	Emblen Park, Central Wagga	4	60.00	Unknown	-25.59	-21.84	3.75	1.39	1.53	0.15
Bore 9	63 Gormly Ave, Central Wagga	MA	48.8	Unknown	-20.17	-21.91	-1.73	0.53	0.53	0.00
H1	Cnr Clark - Mate Sts, Humula	T	4.50	Unknown	-1.14	-1.51	-0.37	2.18	1.61	-0.57
H2	Cnr Boundary Rd - Mount St, Humula	T	4.20	Unknown	-2.33	-2.60	-0.27	0.45	0.44	-0.01
T1	26 Centenary Ave, Tarcutta	T	unknown	Unknown	-9.48	-9.78	-0.31	1.35	1.31	-0.04
T2	Sydney St, Tarcutta	T	unknown	Unknown	-6.81	LOST	NA	1.87	LOST	NA
T3	Cnr Cynthia - Young Sts, Tarcutta	T	16.00	Unknown	-15.72	-15.26	0.46	NETS	0.89	INC
T4	Cnr Argent - Spring Sts, Tarcutta	T	19.50	Unknown	DRY	DRY	DRY	DRY	DRY	DRY
T5	Sydney St, Tarcutta	T	5.75	Unknown	-3.84	-4.24	-0.40	3.84	4.04	0.20
T6	Breaden Sports Ground, Tarcutta	T	4.15	Unknown	-1.48	-1.90	-0.42	0.77	0.88	0.11

**APPENDIX D:
STANDING WATER LEVELS - HISTORICAL
HYDROGRAPHS**

